

of the inspections of paragraphs (e)(1), (e)(2), or (e)(3) of this AD, you must still continue to perform the repetitive inspections of paragraphs (e)(1), (e)(2), and (e)(3) of this AD.

(5) Any reports requested in the NMSB accomplishment instructions referenced in paragraphs (e)(1), (e)(2), and (e)(3) of this AD are not required by this AD.

#### (f) Credit for Previous Actions

If, before the effective date of this AD, you performed the inspections and corrective actions required by paragraph (e)(2) of this AD using RR NMSB No. RB.211-73-G848, Revision 3, dated June 12, 2014, or earlier versions, you met the initial inspection requirements of paragraph (e)(2) of this AD.

#### (g) Definitions

For the purposes of this AD:

(1) An "engine shop visit" is the induction of an engine into the shop for maintenance involving the separation of pairs of major mating engine flanges, except that the separation of engine flanges solely for the purposes of transportation without subsequent engine maintenance is not an engine shop visit.

(2) The fan case LP fuel tubes and clips, and the FOHE mounts and hardware, are eligible for installation if they have passed the inspection requirements of paragraphs (e)(1), (e)(2), and (e)(3) of this AD.

#### (h) Alternative Methods of Compliance (AMOCs)

The Manager, Engine Certification Office, FAA, may approve AMOCs to this AD. Use the procedures found in 14 CFR 39.19 to make your request. You may email your request to: [ANE-AD-AMOC@faa.gov](mailto:ANE-AD-AMOC@faa.gov).

#### (i) Related Information

(1) For more information about this AD, contact Wego Wang, Aerospace Engineer, Engine Certification Office, FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803; phone: 781-238-7134; fax: 781-238-7199; email: [wego.wang@faa.gov](mailto:wego.wang@faa.gov).

(2) Refer to MCAI European Aviation Safety Agency AD 2014-0243R1, dated December 10, 2014 for more information. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov/#/docketDetail;D=FAA-2014-0363>.

(3) RR Alert NMSB No. RB.211-73-AH522, Revision 2, dated July 18, 2014, and earlier versions; RR NMSB No. RB.211-73-AH837, initial issue, dated September 9, 2014; and RR NMSB No. RB.211-73-G848, Revision 3, dated June 12, 2014, and earlier versions; which are not incorporated by reference in this AD, can be obtained from Rolls-Royce plc, using the contact information in paragraph (i)(4) of this proposed AD.

(4) For service information identified in this proposed AD, contact Rolls-Royce plc, Corporate Communications, P.O. Box 31, Derby, England, DE24 8BJ; phone: 011-44-1332-242424; fax: 011-44-1332-249936; email: [http://www.rolls-royce.com/contact/civil\\_team.jsp](http://www.rolls-royce.com/contact/civil_team.jsp); Internet: <http://www.aeromanager.com>.

(5) You may view this service information at the FAA, Engine & Propeller Directorate,

12 New England Executive Park, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

Issued in Burlington, Massachusetts, on April 7, 2015.

**Ann C. Mollica,**

*Acting Directorate Manager, Engine & Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 2015-09001 Filed 4-20-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2014-1130; Directorate Identifier 2015-NE-04-AD]**

**RIN 2120-AA64**

#### **Airworthiness Directives; Pratt & Whitney Turbofan Engines**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all Pratt & Whitney (PW) PW4164-1D, PW4168-1D, PW4168A-1D and PW4170 engines, and certain PW4164, PW4168, and PW4168A turbofan engines. This proposed AD was prompted by fuel nozzle-to-fuel supply manifold interface fuel leaks. This proposed AD would require inspecting fuel nozzles for signs of leakage, replacing hardware as required, and torquing to specified requirement. We are proposing this AD to prevent fuel leaks which could result in engine fire and damage to the airplane.

**DATES:** We must receive comments on this proposed AD by June 22, 2015.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Pratt & Whitney, 400 Main St., East Hartford,

CT 06108; phone: 860-565-8770; fax: 860-565-4503. You may view this service information at the FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

#### *Examining the AD Docket*

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-1130; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### **FOR FURTHER INFORMATION CONTACT:**

Katheryn Malatek, Aerospace Engineer, Engine Certification Office, FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803; phone: 781-238-7747; fax: 781-238-7199; email: [katheryn.malatek@faa.gov](mailto:katheryn.malatek@faa.gov).

#### **SUPPLEMENTARY INFORMATION:**

#### **Comments Invited**

We invite you to send any written relevant data, views, or arguments about this NPRM. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2014-1130; Directorate Identifier 2015-NE-04-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

#### **Discussion**

We received reports of four fuel nozzle leaks in service and an additional six fuel nozzle leaks found during shop visits. The root cause is inadequate torque of the fuel nozzle-to-fuel supply manifold B-nuts for the temperatures that the fuel nozzles experience. This condition, if not corrected, could result in engine fire and damage to the airplane.

## Related Service Information Under 14 CFR Part 51

We reviewed PW Alert Service Bulletin (ASB) No. PW4G-100-A73-44, dated October 10, 2014. This service information contains information regarding fuel nozzle manifold inspection and fuel nozzle-to-fuel supply manifold B-nut torque requirements. This service information is reasonably available because the interested parties have access to it through their normal course of business or see **ADDRESSES** for other ways to access this service information.

## FAA's Determination

We are proposing this NPRM because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

## Proposed AD Requirements

This NPRM would require inspecting the fuel nozzle-to-fuel supply manifold interface for evidence of leaks and replacing hardware in cases where fuel leaks are identified. This NPRM also requires torquing certain B-nuts to the specified requirement.

## Differences Between This Proposed AD and the Service Information

PW ASB No. PW4G-100-A73-44 uses calendar dates for compliance time. This NPRM uses cycles. Using cycles from the effective date of the AD supports the intent of the ASB and ensures adequate compliance time after the effective date of the AD.

## Costs of Compliance

We estimate that this proposed AD would affect about 72 engines installed on airplanes of U.S. registry. The average labor rate is \$85 per hour. We estimate that parts replacement will cost about \$1,356 per engine. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$391,392.

## Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in

air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

## Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska to the extent that it justifies making a regulatory distinction, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

## List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Pratt & Whitney:** Docket No. FAA-2014-1130; Directorate Identifier 2015-NE-04-AD.

### (a) Comments Due Date

We must receive comments by June 22, 2015.

### (b) Affected ADs

None.

## (c) Applicability

This AD applies to all Pratt & Whitney (PW) PW4164-1D, PW4168-1D, PW4168A-1D and PW4170 engines; and all PW4164, PW4168, and PW4168A turbofan engines that have incorporated either PW Service Bulletin (SB) No. PW4G-100-72-214, dated December 15, 2011 or PW SB No. PW4G-100-72-219, Revision 1, dated October 5, 2011.

## (d) Unsafe Condition

This AD was prompted by fuel nozzle-to-fuel supply manifold interface fuel leaks. We are issuing this AD to prevent fuel leaks which could result in engine fire and damage to the airplane.

## (e) Compliance

Comply with this AD within the compliance times specified, unless already done.

(1) Within 800 flight hours after the effective date of this AD, and within every 800 hours since last inspection thereafter, inspect all fuel nozzle-to-fuel supply manifold interfaces for evidence of fuel leaks, soot, and coke formation. Use the Accomplishment Instructions, Part A, of PW Alert Service Bulletin (ASB) No. PW4G-100-A73-44, dated October 10, 2014 to do the inspections.

(2) Replace hardware that fails an inspection. Use the Accomplishment Instructions, Part A, of PW ASB No. PW4G-100-A73-44, dated October 10, 2014 to do the replacement.

## (f) Mandatory Terminating Action

(1) Inspect all fuel nozzle-to-fuel supply manifold interfaces for fuel leaks, soot, and coke formation, replace hardware that fails inspection, and re-torque all fuel nozzle-to-fuel supply manifold B-nuts as follows:

(i) For engines with fewer than 1,500 cycles on the effective date of this AD, before accumulating another 650 cycles, not to exceed 1,900 cycles.

(ii) For engines with 1,500 cycles or more, but fewer than 2,500 cycles on the effective date of this AD, before accumulating another 400 cycles, not to exceed 2,700 cycles.

(iii) For engines with 2,500 cycles or more on the effective date of this AD, before accumulating another 200 cycles.

(2) Use the Accomplishment Instructions, Parts B through E, of PW ASB No. PW4G-100-A73-44, dated October 10, 2014 to do the inspection, replacement, and retorquing.

## (g) Definition

For the purpose of this AD "cycles" is defined as cycles since new or cycles since the incorporation of PW SB No. PW4G-100-72-214, dated December 15, 2011 or SB No. PW4G-100-72-219, Revision 1, dated October 5, 2011.

## (h) Alternative Methods of Compliance (AMOCs)

The Manager, Engine Certification Office, FAA, may approve AMOCs for this AD. Use the procedures found in 14 CFR 39.19 to make your request. You may email your request to: [ANE-AD-AMOC@faa.gov](mailto:ANE-AD-AMOC@faa.gov).

**(i) Related Information**

(1) For more information about this AD, contact Katheryn Malatek, Aerospace Engineer, Engine Certification Office, FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803; phone: 781-238-7747; fax: 781-238-7199; email: [katheryn.malatek@faa.gov](mailto:katheryn.malatek@faa.gov).

(2) PW ASB No. PW4G-100-A73-44, dated October 10, 2014, which is not incorporated by reference, can be obtained from Pratt & Whitney using the contact information in paragraph (j)(3) of this proposed rule.

(3) For service information identified in this proposed rule, contact Pratt & Whitney, 400 Main St., East Hartford, CT 06108; phone: 860-565-8770; fax: 860-565-4503.

(4) You may view this service information at the FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

Issued in Burlington, Massachusetts, on April 10, 2015.

**Ann C. Mollica,**

*Acting Directorate Manager, Engine & Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 2015-08995 Filed 4-20-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF HOMELAND SECURITY

### Coast Guard

#### 33 CFR Part 165

[Docket Number USCG-2015-0181]

**RIN 1625-AA00**

#### **Safety Zone, Low Country Splash, Wando River, Cooper River, and Charleston Harbor, Charleston, SC**

**AGENCY:** Coast Guard, DHS.

**ACTION:** Notice of proposed rulemaking.

**SUMMARY:** The Coast Guard proposes to establish temporary moving safety zone during the Low Country Splash, a swimming race occurring on the Wando River, the Cooper River, and Charleston Harbor, in Charleston, South Carolina. The Low Country Splash is scheduled on May 30, 2015, from 7:30 a.m. to 9:45 a.m. The temporary moving safety zone is necessary to protect swimmers, participant vessels, spectators, and the general public during the event. Persons and vessels would be prohibited from entering the safety zone unless authorized by the Captain of the Port Charleston or a designated representative.

**DATES:** Comments and related material must be received by the Coast Guard on or before May 6, 2015. Requests for

public meetings must be received by the Coast Guard on or before April 30, 2015.

**ADDRESSES:** You may submit comments identified by docket number using any one of the following methods:

(1) Federal eRulemaking Portal:

<http://www.regulations.gov>.

(2) Fax: 202-493-2251.

(3) Mail or Delivery: Docket Management Facility (M-30), U.S. Department of Transportation, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590-0001. Deliveries accepted between 9 a.m. and 5 p.m., Monday through Friday, except federal holidays. The telephone number is 202-366-9329.

See the "Public Participation and Request for Comments" portion of the **SUPPLEMENTARY INFORMATION** section below for further instructions on submitting comments. To avoid duplication, please use only one of these three methods.

**FOR FURTHER INFORMATION CONTACT:** If you have questions on this rule, call or email Chief Warrant Officer Christopher Ruleman, Sector Charleston Office of Waterways Management, Coast Guard; telephone (843)-740-3184, email [Christopher.L.Ruleman@uscg.mil](mailto:Christopher.L.Ruleman@uscg.mil). If you have questions on viewing or submitting material to the docket, call Cheryl Collins, Program Manager, Docket Operations, telephone (202) 366-9826.

#### **SUPPLEMENTARY INFORMATION:**

##### **Table of Acronyms**

DHS Department of Homeland Security

FR Federal Register

NPRM Notice of proposed rulemaking

##### **A. Public Participation and Request for Comments**

We encourage you to participate in this rulemaking by submitting comments and related materials. All comments received will be posted without change to <http://www.regulations.gov> and will include any personal information you have provided.

##### **1. Submitting Comments**

If you submit a comment, please include the docket number for this rulemaking, indicate the specific section of this document to which each comment applies, and provide a reason for each suggestion or recommendation. You may submit your comments and material online at <http://www.regulations.gov>, or by fax, mail, or hand delivery, but please use only one of these means. If you submit a comment online, it will be considered received by the Coast Guard when you successfully transmit the comment. If

you fax, hand deliver, or mail your comment, it will be considered as having been received by the Coast Guard when it is received at the Docket Management Facility. We recommend that you include your name and a mailing address, an email address, or a telephone number in the body of your document so that we can contact you if we have questions regarding your submission.

To submit your comment online, go to <http://www.regulations.gov>, type the docket number USCG-2015-0181 in the "SEARCH" box and click "SEARCH." Click on "Submit a Comment" on the line associated with this rulemaking.

If you submit your comments by mail or hand delivery, submit them in an unbound format, no larger than 8½ by 11 inches, suitable for copying and electronic filing. If you submit comments by mail and would like to know that they reached the Facility, please enclose a stamped, self-addressed postcard or envelope. We will consider all comments and material received during the comment period and may change the rule based on your comments.

##### **2. Viewing Comments and Documents**

To view comments, as well as documents mentioned in this preamble as being available in the docket, go to <http://www.regulations.gov>, type the docket number USCG-2015-0181 in the "SEARCH" box and click "SEARCH." Click on Open Docket Folder on the line associated with this rulemaking. You may also visit the Docket Management Facility in Room W12-140 on the ground floor of the Department of Transportation West Building, 1200 New Jersey Avenue SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

##### **3. Privacy Act**

Anyone can search the electronic form of comments received into any of our dockets by the name of the individual submitting the comment (or signing the comment, if submitted on behalf of an association, business, labor union, etc.). You may review a Privacy Act notice regarding our public dockets in the January 17, 2008, issue of the **Federal Register** (73 FR 3316).

##### **4. Public Meeting**

We do not now plan to hold a public meeting. But you may submit a request for one, using one of the methods specified under **ADDRESSES**. Please explain why you believe a public meeting would be beneficial. If we determine that one would aid this