

Costs of Compliance

We estimate that this AD will affect 16 helicopters of U.S. Registry.

We estimate that operators may incur the following costs in order to comply with this AD. We estimate a minimal cost to change the life limit of the ring gear. If required, we estimate it would take 27.5 hours to replace a ring gear carrier assembly at \$85 per work hour. Required parts would cost \$7,591 for a total of \$9,929 per helicopter.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska to the extent that it justifies making a regulatory distinction; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared an economic evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2015-11-09 Sikorsky Aircraft Corporation (Type Certificate Previously Held By Schweizer Aircraft Corporation): Amendment 39-18172; Docket No. FAA-2014-1020; Directorate Identifier 2013-SW-078-AD.

(a) Applicability

This AD applies to Sikorsky Aircraft Corporation Model 269D and Model 269D Configuration A helicopters with ring gear carrier assembly, part number (P/N) 269A5194, installed, certificated in any category.

(b) Unsafe Condition

This AD defines the unsafe condition as a fatigue crack in a ring gear carrier assembly. This condition could result in failure of the main rotor transmission, loss of engine power to the main rotor, and subsequent loss of control of the helicopter.

(c) Effective Date

This AD becomes effective July 14, 2015.

(d) Compliance

You are responsible for performing each action required by this AD within the specified compliance time unless it has already been accomplished prior to that time.

(e) Required Actions

Before further flight:

- (1) Revise the Airworthiness Limitations Section of the applicable maintenance manual by reducing the life limit of the ring gear carrier assembly, P/N 269A5194, from 6,000 hours time-in-service (TIS) to 5,000 hours TIS.
- (2) Remove from service any ring gear carrier assembly, P/N 269A5194, with 5,000 or more hours TIS.

(f) Alternative Methods of Compliance (AMOCs)

- (1) The Manager, New York Aircraft Certification Office, FAA, may approve AMOCs for this AD. Send your proposal to: Norman Perenson, Aviation Safety Engineer, New York Aircraft Certification Office, Propulsion & Services Branch, FAA, 1600

Stewart Ave., Westbury, New York; telephone (516) 228-7337; email Norman.Perenson@faa.gov.

(2) For operations conducted under a 14 CFR part 119 operating certificate or under 14 CFR part 91, subpart K, we suggest that you notify your principal inspector, or lacking a principal inspector, the manager of the local flight standards district office or certificate holding district office before operating any aircraft complying with this AD through an AMOC.

(g) Additional Information

Sikorsky 269D Helicopter Alert Service Bulletin No. ASB DB-040A, Revision A, dated December 4, 2012, which is not incorporated by reference, contains additional information about the subject of this AD. For service information identified in this AD, contact Sikorsky Aircraft Corporation, Customer Service Engineering, 124 Quarry Road, Trumbull, CT 06611; telephone 1-800-Winged-S or 203-416-4299; email sikorskywcs@sikorsky.com. You may review a copy of information at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137.

(h) Subject

Joint Aircraft Service Component (JASC) Code: 6300 Main Rotor Drive System.

Issued in Fort Worth, Texas, on May 29, 2015.

Lance T. Gant,

Acting Directorate Manager, Rotorcraft Directorate, Aircraft Certification Service.

[FR Doc. 2015-13846 Filed 6-8-15; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2014-0493; Directorate Identifier 2013-SW-019-AD; Amendment 39-18173; AD 2015-11-10]

RIN 2120-AA64

Airworthiness Directives; Sikorsky Aircraft Corporation (Sikorsky) Model Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for Sikorsky Model S-92A helicopters. This AD requires installing a main gearbox (MGB) failed pump sensor and vacuum switch wiring, installing an MGB oil auto bypass system, activating Aircraft Management System (AMS) 7.1 software to show a new visual warning, and installing updated enhanced ground proximity warning system (EGPWS) software that includes an aural

annunciation of a complete oil pressure loss condition. This AD also requires inserting a Rotorcraft Flight Manual (RFM) Supplement into the applicable RFM. This AD was prompted by investigation results of in-service oil leakage incidents. The actions are intended to alert and prevent MGB oil loss, which could lead to failure of the MGB and subsequent loss of control of the helicopter.

DATES: This AD is effective July 14, 2015.

The Director of the Federal Register approved the incorporation by reference of a certain document listed in this AD as of July 14, 2015.

ADDRESSES: For service information identified in this AD, contact Sikorsky Aircraft Corporation, Customer Service Engineering, 124 Quarry Road, Trumbull, CT 06611; telephone 1-800-Winged-S or 203-416-4299; email sikorskywcs@sikorsky.com; or at <http://www.sikorsky.com>. For the Honeywell service information identified in this proposed AD, contact Honeywell International, Inc., at 15001 NE. 36 Street, Redmond, WA 98052-5316, telephone (800) 601-3099; email www.myaerospace.com. You may review a copy of the referenced service information at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at the Docket Operations Office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, any incorporated-by-reference service information, the economic evaluation, any comments received, and other information. The street address for the Docket Operations Office (phone: 800-647-5527) is U.S. Department of Transportation, Docket Operations Office, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Michael Schwetz, Aviation Safety Engineer, Boston Aircraft Certification Office, Engine & Propeller Directorate, FAA, 12 New England Executive Park, Burlington, Massachusetts 01803; telephone (781) 238-7761; email michael.schwetz@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

On July 23, 2014, at 79 FR 42719, the **Federal Register** published our notice of

proposed rulemaking (NPRM), which proposed to amend 14 CFR part 39 by adding an AD that would apply to certain serial-numbered Sikorsky Model S-92A helicopters. The NPRM proposed to require inserting an RFM Supplement into the applicable RFM, and depending on the helicopter's serial number, installing an MGB failed pump sensor and vacuum switch wiring, installing an MGB oil auto bypass system, activating AMS 7.1 software to show a new MGB "OIL OUT" visual warning, and updating the EGPWS software to include an aural annunciation of a complete oil pressure loss condition.

The proposed AD was prompted by one accident and one in-service oil leakage incident where it was discovered during subsequent investigations that the pilot failed to activate the bypass valve within 5 seconds of the oil pressure dropping below 35 psi, as required by the RFM. Both accident and incident investigations found that the pilot activated the bypass valve well beyond the 5 seconds. The manual operation of the bypass valve within 5 seconds of the oil pressure dropping below 35 psi has proven not to be a realistic expectation. The proposed requirements were intended to alert and prevent MGB oil loss, which could lead to failure of the MGB and subsequent loss of control of the helicopter.

Comments

Sikorsky commented that it supported issuing the AD but felt portions of the "Discussion" section in the preamble of the NPRM (79 FR 42719, July 23, 2014) needed clarification.

We agree with some of the commenter's language regarding the function of the MGB oil auto bypass system. However, the commenter has not requested that we change the proposed rule.

FAA's Determination

We have reviewed the relevant information and determined that an unsafe condition exists and is likely to exist or develop on other products of the same type design and that air safety and the public interest require adopting the AD requirements as proposed.

Related Service Information Under 14 CFR Part 51

We reviewed Sikorsky S-92A Rotorcraft Flight Manual (RFM) Supplement No. 45, Part I, dated July 30, 2012. The RFM supplement provides preflight checks and emergency procedures for the oil pump failure indicating system and the MGB auto bypass. This information is

reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section of this AD.

Other Related Service Information

Sikorsky has issued the following service information:

- Alert Service Bulletin (ASB) No. 92-63-024C, Revision C, dated October 7, 2011, for certain serial-numbered helicopters specifies installing a main module input gear box switch assembly and modifying the MGB vacuum switch wiring. Before making the modification, the ASB states an AMS 4.1 or greater version must first be installed and the following Customer Service Notices (CSN) completed: CSN 92-068C, Revision C, dated March 27, 2012, and CSN 92-069A, Revision A, dated November 10, 2011.

- ASB 92-63-027, Basic Issue, dated January 21, 2013, for certain serial-numbered helicopters specifies installing an MGB oil pressure automatic bypass system, activating an MGB "OIL OUT" visual warning in the AMS 7.1 software, and performing systems operational checkout procedures. Before or when installing the MGB oil pressure auto bypass system, the ASB states the following must be complied with: CSN 92-089, Basic Issue, dated January 10, 2013; ASB 92-34-002, Basic Issue, dated January 21, 2013; and ASB 92-63-024C, Revision C, dated October 7, 2011.

- ASB 92-34-002, Basic Issue, dated January 21, 2013, for certain serial-numbered helicopters with certain part-numbered EGPWS installed, specifies installing EGPWS updated software version 030, which adds an MGB "OIL OUT" aural warning, in accordance with Honeywell International, Inc., Service Bulletin 965-1595-34-23, Revision 0, dated March 13, 2012. Before or during installation of the updated software, the ASB states the following must be complied with: ASB 92-63-027, Basic Issue, dated January 21, 2013, and CSN 92-089, Basic Issue, dated January 10, 2013.

Differences Between This AD and the Service Information

This AD requires compliance within 500 hours time-in-service, and the service information specifies certain dates and calendar times.

Costs of Compliance

We estimate that this AD will affect 44 helicopters of U.S. Registry.

We estimate that operators may incur the following costs in order to comply with this AD. Labor costs are estimated

at \$85 per hour. The work hours and required parts costs are estimated as follows:

- .5 work hour to insert the RFM Supplement into the RFM.
- 8 work hours plus \$2,200 for required parts to install an MGB failed pump sensor;
- 4 work hours plus \$250 for required parts to install MGB vacuum switch wiring;
- 71.7 work hours plus \$4,100 for required parts to install an MGB oil pressure auto bypass system;
- 1 work hour to activate AMS 7.1; and
- 1 work hour plus \$500 for required parts to install EGPWS software.

The total cost of compliance for all actions will be about \$14,377 per helicopter and \$632,588 for the U.S. fleet.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
- (3) Will not affect intrastate aviation in Alaska to the extent that it justifies making a regulatory distinction; and
- (4) Will not have a significant economic impact, positive or negative,

on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared an economic evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2015–11–10 Sikorsky Aircraft Corporation:
Amendment 39–18173; Docket No. FAA–2014–0493; Directorate Identifier 2013–SW–019–AD.

(a) Applicability

This AD applies to Model S–92A helicopters, serial number (S/N) 920006 through 920179, certificated in any category.

(b) Unsafe Condition

This AD defines the unsafe condition as main gearbox (MGB) oil loss, which could lead to failure of the MGB and subsequent loss of control of the helicopter.

(c) Effective Date

This AD becomes effective July 14, 2015.

(d) Compliance

You are responsible for performing each action required by this AD within the specified compliance time unless it has already been accomplished prior to that time.

(e) Required Actions

Within 500 hours time-in-service:

- (1) Insert a copy of the Sikorsky S–92A Rotorcraft Flight Manual (RFM) Supplement No. 45, Part I, dated July 30, 2012, into the RFM.
- (2) For helicopters with S/N 920006 through 920132:
 - (i) Install an MGB failed pump sensor, Modification Kit Part Number (P/N) 92070–35007–011.
 - (ii) Install MGB vacuum switch wiring, Modification Kit P/N 92070–55039–013.
- (3) For helicopters with S/N 920006 through 920179:
 - (i) Install an MGB auto bypass system, Modification Kit P/N 92070–55061–011.
 - (ii) Activate Aircraft Management System 7.1 software to show a new MGB "OIL OUT" visual warning.

(iii) Install enhanced ground proximity warning system software version 030.

(f) Special Flight Permit

Special flight permits are prohibited.

(g) Alternative Methods of Compliance (AMOC)

(1) The Manager, Boston Aircraft Certification Office, FAA, may approve AMOCs for this AD. Send your proposal to: Michael Schwetz, Aviation Safety Engineer, Boston Aircraft Certification Office, Engine & Propeller Directorate, FAA, 12 New England Executive Park, Burlington, Massachusetts 01803; telephone (781) 238–7761; email michael.schwetz@faa.gov.

(2) For operations conducted under a 14 CFR part 119 operating certificate or under 14 CFR part 91, subpart K, we suggest that you notify your principal inspector, or lacking a principal inspector, the manager of the local flight standards district office or certificate holding district office before operating any aircraft complying with this AD through an AMOC.

(h) Additional Information

Sikorsky Alert Service Bulletin (ASB) No. 92–63–024C, Revision C, dated October 7, 2011; Sikorsky ASBs 92–63–027 and 92–34–002, both Basic Issue and both dated January 21, 2013; Sikorsky Customer Service Notice (CSN) 92–068C, Revision C, dated March 27, 2012; CSN 92–069A, Revision A, dated November 10, 2011; CSN 92–089, Basic Issue, dated January 10, 2013; and Honeywell International, Inc., Service Bulletin 965–1595–34–23, Revision 0, dated March 13, 2012, which are not incorporated by reference, contain additional information about the subject of this AD. For service information identified in this AD, contact Sikorsky Aircraft Corporation, Customer Service Engineering, 124 Quarry Road, Trumbull, CT 06611; telephone 1–800–Winged–S or 203–416–4299; email sikorskywcs@sikorsky.com; or at <http://www.sikorsky.com> and Honeywell International, Inc., at 15001 NE. 36 Street, Redmond, WA 98052–5316, telephone (800) 601–3099; or at www.myaerospace.com. You may review a copy of this service information at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137.

(i) Subject

Joint Aircraft Service Component (JASC) Code: 6320 Main Rotor Gearbox.

(j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Sikorsky S–92A Rotorcraft Flight Manual Supplement No. 45, Part I, dated July 30, 2012.

(ii) Reserved.

(3) For Sikorsky service information identified in this AD, contact Sikorsky Aircraft Corporation, Customer Service

Engineering, 124 Quarry Road, Trumbull, CT 06611; telephone 1-800-Winged-S or 203-416-4299; email sikorskywcs@sikorsky.com; or at <http://www.sikorsky.com>.

(4) You may view this service information at FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137. For information on the availability of this material at the FAA, call (817) 222-5110.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call (202) 741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Fort Worth, Texas, on May 29, 2015.

Lance T. Gant,

Acting Directorate Manager, Rotorcraft Directorate, Aircraft Certification Service.

[FR Doc. 2015-13844 Filed 6-8-15; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA-2015-1650; Airspace Docket No. 14-AEA-8]

RIN 2120-AA66

Amendment of VOR Federal Airways; Northeastern United States

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: This action amends VOR Federal Airways V-31, V-36, V-98, V-164 and V-252 by removing from the route descriptions, those segments that extend into and/or through Canadian airspace. This action is necessary to match route changes made by Canada as part of the Windsor-Toronto-Montreal (W-T-M) project. The route segments in Canada are no longer in effect; therefore, the United States has issued Notices to Airmen (NOTAM) identifying the affected segments as “not authorized” pending the deletion of the segments from the route descriptions through this rulemaking action.

DATES: Effective date: 0901 UTC, August 20, 2015. The Director of the Federal Register approves this incorporation by reference action under 1 CFR part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

ADDRESSES: FAA Order 7400.9Y, Airspace Designations and Reporting Points, and subsequent amendments can

be viewed online at http://www.faa.gov/air_traffic/publications/. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call (202) 741-6030, or go to http://www.archives.gov/federal-register/code_of_federal-regulations/ibr_locations.html.

FAA Order 7400.9, Airspace Designations and Reporting Points, is published yearly and effective on September 15. For further information, you can contact the Airspace Policy and Regulations Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783.

FOR FURTHER INFORMATION CONTACT: Paul Gallant, Airspace Policy and Regulations Group, Office of Airspace Services, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783.

SUPPLEMENTARY INFORMATION:

Authority for This Rulemaking

The FAA’s authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency’s authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of the airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it is merely an editorial change to the legal descriptions of V-31, V-36, V-98, V-164 and V-252 to reflect changes in the Canadian route structure.

Background

This action amends VOR Federal airways V-31, V-36, V-98, V-164 and V-252 as a result of the Windsor-Toronto-Montreal (W-T-M) and Northeast United States Cross-border Airspace Modernization and Redesign initiative. NavCanada, in an effort to transition to an Area Navigation (RNAV) route system, removed a number of conventional airways, many of which crossed the United States/Canadian border. The airways listed above with the exception of V-98 were part of that initiative that became effective on November 13, 2014 (79 FR 57758). Canadian segments of V-98 were

subsequently removed by Canada in January 2015. Coordination for the modification of the Federal airways listed above was not completed in time for inclusion in the November 13, 2014, docket action. Currently, the United States has issued regulatory Notices to Airman (NOTAM) classifying the segments of the above listed airways lying within Canadian airspace as “not authorized.”

This action is required to match the changes in the Canadian route structure. It will enhance safety within the National Airspace System and will facilitate a seamless air traffic route system between the two countries.

Availability and Summary of Documents for Incorporation by Reference

This document amends FAA Order 7400.9Y, Airspace Designations and Reporting Points, dated August 6, 2014, and effective September 15, 2014. FAA Order 7400.9Y is publicly available as listed in the **ADDRESSES** section of this final rule. FAA Order 7400.9Y lists Class A, B, C, D, and E airspace areas, air traffic service routes, and reporting points.

The Rule

This action amends Title 14 Code of Federal Regulations (14 CFR) part 71 by removing those former route segments in Canadian airspace from the descriptions of VOR Federal airways V-31, V-36, V-98, V-164 and V-252. This action aligns the United States airways with route changes instituted by Canada as part of NavCanada’s W-T-M project.

The following is a summary of the specific changes by route. Where new navigation aid radials are designated, both True and Magnetic degrees are stated. Otherwise, only True degrees are shown.

V-31 The segment between the intersection of the Rochester 279° and the Toronto, Canada 150° radials is removed and a new end point formed by the intersection of the Rochester 279° and the Buffalo, NY 023°(T)/031°(M) radials is inserted.

V-36 The segments between Thunder Bay, ON, Canada and the intersection of the Toronto and Buffalo radials is removed. The amended route extends between Buffalo, NY and the intersection of the LaGuardia, NY 310° and the Stillwater, NJ 043° radials as currently published.

V-98 The segments between Windsor, ON, Canada and St. Jean, PQ, Canada are removed.

V-164 The segment between Toronto, ON, Canada and Buffalo, NY is removed. The amended route extends