

**(i) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Schempp-Hirth Flugzeugbau GmbH Technical Note No. 380-2/396-17/868-22/890-14, Revision 1, issued July 13, 2015 (published as a single document).

(ii) Schempp-Hirth Flugzeugbau GmbH Working instruction for Technical Note No. 380-2/396-17/868-22/890-14, Ausgabe (English translation: issue) 1, Datum (English translation: dated) May 11, 2015.

(3) For Schempp-Hirth Flugzeugbau GmbH service information identified in this AD, contact Schempp-Hirth Flugzeugbau GmbH, Krehenstrasse 25, 73230 Kirchheim/Teck, Germany; telephone: +49 7021 7298-0; fax: +49 7021 7298-199; email: [info@schempp-hirth.com](mailto:info@schempp-hirth.com); Internet: <http://www.schempp-hirth.com>.

(4) You may view this service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. In addition, you can access this service information on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-3224.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on October 1, 2015.

**Melvin Johnson,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-25710 Filed 10-13-15; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2015-4085; Directorate Identifier 2015-CE-033-AD; Amendment 39-18292; AD 2015-20-13]

**RIN 2120-AA64**

**Airworthiness Directives; Piper Aircraft, Inc. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain

Piper Aircraft, Inc. Models PA-28-161, PA-28-181, and PA-28R-201 airplanes. This AD requires inspecting the right wing rib at wing station 140.09 for cracks and taking necessary corrective action. This AD was prompted by a report of cracks found in the wing rib bead radius that were formed during production. We are issuing this AD to correct the unsafe condition on these products.

**DATES:** This AD is effective October 29, 2015.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of October 29, 2015.

We must receive comments on this AD by November 30, 2015.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this AD, contact Piper Aircraft, Inc., Customer Service, 2926 Piper Drive, Vero Beach, Florida 32960; telephone: (877) 879-0275; fax: none; email: [customer.service@piper.com](mailto:customer.service@piper.com); Internet: [www.piper.com](http://www.piper.com). You may review the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the Internet at <http://www.regulations.gov> by searching for locating Docket No. FAA-2015-4085.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-4085; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for

the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:**

Gregory "Keith" Noles, Aerospace Engineer, FAA, Atlanta Aircraft Certification Office, 1701 Columbia Avenue, College Park, Georgia 30337; phone: (404) 474-5551; fax: (404) 474-5606; email: [gregory.noles@faa.gov](mailto:gregory.noles@faa.gov).

**SUPPLEMENTARY INFORMATION:****Discussion**

We received a report from Piper Aircraft, Inc. of a production quality control problem on certain Models PA-28-161, PA-28-181, and PA-28R-201 airplanes. A change in production tooling and processes caused cracks to form along the edge of rib stiffening beads during manufacture. These cracks cause reduced structural integrity of the wing, which results in the inability of the wing rib to carry ultimate load.

This condition, if not corrected, could result in reduced structural integrity of the wing with consequent loss of control. We are issuing this AD to correct the unsafe condition on these products.

**Related Service Information Under 14 CFR Part 51**

We reviewed Piper Aircraft, Inc. Service Bulletin No. 1279, dated August 26, 2015. The service bulletin describes procedures for inspecting the right wing rib at wing station 140.09 for cracks and for obtaining an FAA-approved repair if cracks are found. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section of this AD.

**FAA's Determination**

We are issuing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**AD Requirements**

This AD requires accomplishing the actions specified in the service information described previously.

**FAA's Justification and Determination of the Effective Date**

An unsafe condition exists that requires the immediate adoption of this AD. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because cracks in the wing rib, if not detected and corrected immediately,

could result in reduced structural integrity of the wing with consequent loss of control. Therefore, we find that notice and opportunity for prior public comment are impracticable and that good cause exists for making this amendment effective in less than 30 days.

**Comments Invited**

This AD is a final rule that involves requirements affecting flight safety and was not preceded by notice and an opportunity for public comment. However, we invite you to send any

written data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include the docket number FAA-2015-4085 and Directorate Identifier 2015-CE-033-AD at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

**Costs of Compliance**

We estimate that this AD affects 15 airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspect the right wing rib at wing station 140.09 for cracks.	1 work-hour × \$85 per hour = \$85 .....	Not applicable .....	\$85	\$1,275

We estimate the following costs to do any necessary repairs that would be required based on the results of the

inspection. This estimate is based on replacement of the rib. We have no way

of determining the number of airplanes that might need these repairs:

**ON-CONDITION COSTS**

Action	Labor cost	Parts cost	Cost per product
Repair of the of the wing rib .....	35 work-hours × \$85 per hour = \$2,975 .....	\$125	\$3,100

According to the manufacturer, some of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator.

“Subtitle VII: Aviation Programs” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on

products identified in this rulemaking action.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2015-20-13 Piper Aircraft, Inc.:**  
Amendment 39-18292; Docket No. FAA-2015-4085; Directorate Identifier 2015-CE-033-AD.

**(a) Effective Date**

This AD is effective October 29, 2015.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Piper Aircraft, Inc. Model PA-28-161 airplanes, serial numbers 2842393 through 2842395; Model PA-28-181 airplanes, serial numbers 2843769 through

2843775 and 2843779 through 2843791; and Model PA-28R-201 airplanes, serial number 2844152, certificated in any category.

**(d) Subject**

Joint Aircraft System Component (JASC)/ Air Transport Association (ATA) of America Code 5712, Wing Ribs/Bulkhead.

**(e) Unsafe Condition**

This AD was prompted by a report of cracks found in the wing rib bead radius that were formed during production. We are issuing this AD to detect and correct cracks in the wing rib, which if not corrected, could result in reduced structural integrity of the wing with consequent loss of control.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspect**

(1) Within the next 25 hours time-in-service after October 29, 2015 (the effective date of this AD), inspect the right wing rib at wing station (WS) 140.09 for cracks following the INSTRUCTIONS section of Piper Aircraft, Inc. Service Bulletin No. 1279, dated August 26, 2015.

(2) If any crack is detected during the inspection required by paragraph (g)(1) of this AD, before further flight, obtain and implement an FAA-approved repair scheme, approved specifically for this AD. At the operator's discretion, assistance may be provided by contacting Piper Aircraft, Inc. at the address identified in paragraph (k)(3) of this AD.

**(h) Special Flight Permit**

A special flight permit is allowed without limitations for the inspection required in paragraph (g)(1) of this AD. If a crack is found during the inspection required in paragraph (g)(1) of this AD, a special flight permit is allowed with the following limitations:

- (1) Flight must be planned to the nearest location where repairs can be done;
- (2) Indicated airspeed must be 120 knots or less for the entire flight;
- (3) Bank angle is not to exceed 30 degrees for the entire flight;
- (4) Maximum load factors must be between +3.0 and -1.0 for the entire flight; and
- (5) Flight must be performed VFR, with no turbulence greater than "light" forecast for the planned flight route and altitude.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Atlanta ACO, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (j) of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(j) Related Information**

For more information about this AD, contact Gregory "Keith" Noles, Aerospace Engineer, FAA, Atlanta ACO, 1701 Columbia Avenue, College Park, Georgia 30337; phone: (404) 474-5551; fax: (404) 474-5606; email: [gregory.noles@faa.gov](mailto:gregory.noles@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Piper Aircraft, Inc. Service Bulletin No. 1279, dated August 26, 2015.

(ii) Reserved.

(3) For Piper Aircraft, Inc. service information identified in this AD, contact Piper Aircraft, Inc., Customer Service, 2926 Piper Drive, Vero Beach, Florida 32960; telephone: (877) 879-0275; fax: none; email: [customer.service@piper.com](mailto:customer.service@piper.com); Internet: [www.piper.com](http://www.piper.com).

(4) You may review the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the Internet at <http://www.regulations.gov> by searching for locating Docket No. FAA-2015-4085.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on October 1, 2015.

**Melvin Johnson,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-25723 Filed 10-13-15; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 73**

**[Docket No. FAA-2015-3758; Airspace Docket No. 15-ACE-1]**

**RIN 2120-AA66**

**Modification to Restricted Areas R-3602A and R-3602B; Manhattan, KS**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule, technical amendment.

**SUMMARY:** This action amends Restricted Areas R-3602A and R-3602B,

Manhattan, KS, to accurately identify the R-3602A and R-3602B boundary segments described using the Chicago, Rock Island and Pacific Railroad right-of-way, the R-3602A and R-3602B shared boundary segment described using Old U.S. Highway 77, and the R-3602A and Riley Military Operations Area (MOA) shared boundary segment described using the Milford Reservoir shoreline. The restricted area ceilings are also amended to be expressed as flight levels (FL), the Marshall Army Air Field Radio Beacon (RBN) referenced in R-3602B is changed to the Cavalry Nondirectional Beacon (NDB), and the restricted areas using agency information is updated to include the military service of the using agency. This action does not affect the overall restricted area boundaries, designated altitudes, times of designation, or activities conducted within the restricted areas. Additionally, boundary segment amendments of the Riley MOA, ancillary to the restricted area amendments, are being made. Since the R-3602A and R-3602B restricted areas share boundaries with the Riley MOA, the FAA included discussion of the Riley MOA amendments in this rule. Lastly, the MOA using agency is being amended to match the restricted areas using agency information.

**DATES:** Effective date 0901 UTC, December 10, 2015.

**FOR FURTHER INFORMATION CONTACT:**

Colby Abbott, Airspace Policy Group, Office of Airspace Services, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783.

**SUPPLEMENTARY INFORMATION:**

**Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority.

This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of the airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it makes administrative changes to the descriptions of restricted areas R-3602A and R-3602B, Fort Riley, KS.