

(4) Bombardier Service Bulletin 700–52–6008, Revision 01, dated February 3, 2015 (for Model BD–700–1A10 airplanes).

(h) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using the following service information, as applicable. This service information is not incorporated by reference in this AD.

- (1) Bombardier Service Bulletin 700–1A11–52–021, dated November 9, 2012.
- (2) Bombardier Service Bulletin 700–52–044, dated November 9, 2012.
- (3) Bombardier Service Bulletin 700–52–5008, dated November 9, 2012.
- (4) Bombardier Service Bulletin 700–52–6008, dated November 9, 2012.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) **Alternative Methods of Compliance (AMOCs):** The Manager, New York Aircraft Certification Office (ACO), ANE–170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) **Contacting the Manufacturer:** For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE–170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF–2015–03, dated March 25, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–8435.

(2) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–5000; fax 514–855–7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on December 30, 2015.

Phil Forde,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016–00169 Filed 1–12–16; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2015–8434; Directorate Identifier 2015–NM–082–AD]

RIN 2120–AA64

Airworthiness Directives; Bombardier Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model DHC–8–401 and –402 airplanes. This proposed AD was prompted by a discovery of cracking on two test spoiler power control unit (PCU) manifolds during testing by the manufacturer. This proposed AD would require replacement of affected spoiler PCUs. We are proposing this AD to prevent cracking of the spoiler PCUs that could lead to the loss of multiple flight controls and landing gear systems.

DATES: We must receive comments on this proposed AD by February 29, 2016.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202–493–2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416–375–4000; fax 416–375–4539; email thd.qseries@aero.bombardier.com;

Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–8434; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Cesar Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE–171, FAA, New York Aircraft Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7318; fax 516–794–5531.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2015–8434; Directorate Identifier 2015–NM–082–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

Transport Canada Civil Aviation, which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF–2015–07, dated April 28, 2015 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Bombardier, Inc. Model

DHC-8-401 and -402 airplanes. The MCAI states:

During endurance and impulse testing of the spoiler PCU, cracks were discovered on two test spoiler PCU manifolds. Investigation determined that the crack initiation was due to the heat treat process. A cracked spoiler PCU manifold could cause the loss of one of the two hydraulic systems, resulting in the loss of multiple flight controls and landing gear systems. This condition, if not corrected, could adversely affect the continued safe operation and landing of the aeroplane.

This [Canadian] AD mandates the replacement of the affected spoiler PCUs.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-8434.

Related Service Information Under 1 CFR Part 51

Bombardier, Inc. has issued Bombardier Service Bulletin 84-27-64, dated July 15, 2014. The service information describes procedures for identification and replacement of affected spoiler PCU manifolds. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

Costs of Compliance

We estimate that this proposed AD affects 82 airplanes of U.S. registry.

We also estimate that it would take about 2 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$10,000 per product. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$833,940, or \$10,170 per product.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I,

section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

Bombardier, Inc.: Docket No. FAA-2015-8434; Directorate Identifier 2015-NM-082-AD.

(a) Comments Due Date

We must receive comments by February 29, 2016.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Bombardier, Inc. Model DHC-8-401 and -402 airplanes, certificated in any category, serial numbers (S/Ns) 4001, and 4003 through 4453 inclusive, equipped with spoiler power control unit (PCU) part numbers (P/Ns) 390700-1007 and 1009, S/Ns 0474 through 1321 and 1394 through 1876 without suffix "A."

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight Control System.

(e) Reason

This AD was prompted by the discovery of cracking on two test spoiler power control unit (PCU) manifolds during testing by the manufacturer. We are issuing this AD to prevent cracking of the spoiler PCUs that could lead to the loss of multiple flight controls and landing gear systems.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Inspection/Replacement

Within 12,000 flight hours or 72 months after the effective date of this AD, whichever occurs first: Remove and replace the affected spoiler PCUs in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 84-27-64, dated July 15, 2014.

(h) Parts Installation Prohibition

After paragraph (g) of this AD has been done, no person may install, on any airplane, a spoiler PCU, part number 390700-1007 or -1009, serial numbers 0474 through 1321 and 1394 through 1876, without suffix "A."

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC

approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2015-07, dated April 28, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-8434.

(2) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email thd.qseries@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on December 31, 2015.

Phil Forde,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-00171 Filed 1-12-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2015-8432; Directorate Identifier 2015-NM-100-AD]

RIN 2120-AA64

Airworthiness Directives; Saab AB, Saab Aeronautics (Formerly Known as Saab AB, Saab Aerosystems) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Saab AB, Saab Aeronautics Model 340A (SAAB/SF340A) and SAAB 340B airplanes. This proposed AD was prompted by reports of ruptured horizontal stabilizer de-icing boots. This proposed AD would require a revision of the applicable airplane flight manual (AFM), repetitive inspections of the

horizontal stabilizer de-icing boots, and applicable corrective actions. We are proposing this AD to detect and correct damage of the de-icing boot; such damage could lead to a ruptured boot, severe vibrations, and possible reduced control of the airplane.

DATES: We must receive comments on this proposed AD by February 29, 2016.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Saab AB, Saab Aeronautics, SE-581 88, Linköping, Sweden; telephone +46 13 18 5591; fax +46 13 18 4874; email saab2000.techsupport@saabgroup.com; Internet <http://www.saabgroup.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-8432; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Shahram Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-1112; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2015-8432; Directorate Identifier 2015-NM-100-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2015-0129, dated July 6, 2015 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Saab AB, Saab Aeronautics Model 340A (SAAB/SF340A) and SAAB 340B airplanes. The MCAI states:

There have been some reported events of ruptured horizontal stabilizer de-icing boots. In-flight rupture of a de-icing boot will result in complete loss of the de-icing function within its associated zone. In addition, in some of these events, the de-icing boot had formed a large open scoop.

This condition, if not detected and corrected, could lead to severe vibrations, possibly resulting in reduced control of the aeroplane.

To address this potential unsafe condition, SAAB issued Alert Operations Bulletin (AOB) No.12 and AOB No. 23 as a temporary measure, recommending performing a flap 0 landing in the event of a suspected rupture of the de-icing boot on the horizontal stabilizer.

In addition, SAAB issued SB 340-30-094 to provide instructions to inspect the affected de-icing boots.

For the reasons described above, this [EASA] AD requires an amendment of the applicable Airplane Flight Manual (AFM) and, pending the development of a modification by SAAB, repetitive inspections of the horizontal stabilizer de-icing boots and, depending on findings, accomplishment of applicable corrective action(s).

This [EASA] AD is considered to be an interim action and further AD action may follow.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for