

TABLE 1 TO PARAGRAPH (i) OF THIS AD—REPLACEMENT COMPLIANCE TIMES

Year of manufacture	Compliance time
2002	Within 12 months after the effective date of this AD.
2003	Within 16 months after the effective date of this AD.
2004	Within 20 months after the effective date of this AD.
2005	Within 24 months after the effective date of this AD.
2006	Within 28 months after the effective date of this AD.
2007	Within 32 months after the effective date of this AD.
2008	Within 36 months after the effective date of this AD.
2009	Before exceeding 10 years since date of manufacture of the passenger chemical oxygen generator.

(j) Definition of Serviceable

For the purpose of this AD, a serviceable unit is a passenger chemical oxygen generator having P/N 117042-XX (XX represents any numerical value) with a manufacturing date not older than 10 years, or any other approved part number, provided that the generator has not exceeded the life limit established for that generator by the manufacturer.

(k) Reporting

At the applicable time specified in paragraph (k)(1) or (k)(2) of this AD, submit a report of the findings (both positive and negative) of the inspection required by paragraph (g) of this AD, in accordance with paragraph 7., "Reporting," of Airbus AOT A35W008-14, dated December 18, 2014, including Appendix A, undated. The report must include the information specified in Appendix A, undated, of Airbus AOT A35W008-14, dated December 18, 2014.

(1) If the inspection was done on or after the effective date of this AD: Submit the report within 30 days after the inspection.

(2) If the inspection was done before the effective date of this AD: Submit the report within 30 days after the effective date of this AD.

(l) Parts Installation Limitation

As of the effective date of this AD, no person may install a passenger chemical oxygen generator, unless it is determined, prior to installation, that the oxygen generator is a serviceable unit (as defined in paragraph (j) of this AD).

(m) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Dan Rodina, Aerospace Engineer, International Branch, ANM-116 Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-227-2125; fax: 425-227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify

your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Reporting Requirements*: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

(n) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2015-0118, dated June 24, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-7528.

(o) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Airbus Alert Operators Transmission (AOT) A35W008-14, dated December 18, 2014, including Appendix A, undated.

(ii) B/E Aerospace Service Bulletin 117042-35-001, dated December 10, 2014.

(3) For Airbus service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone: +33 5 61 93 36 96; fax: +33 5 61 93 44 51; email: account.airworth-eas@airbus.com; Internet <http://www.airbus.com>.

(4) For B/E Aerospace service information identified in this AD, contact B/E Aerospace Inc., 10800 Pflumm Road, Lenexa, KS 66215; telephone: 913-338-9800; fax: 913-469-8419; Internet <http://beaerospace.com/home/globalsupport>.

(5) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(6) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on May 12, 2016.

Suzanne Masterson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-12156 Filed 5-25-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2015-2457; Directorate Identifier 2014-NM-209-AD; Amendment 39-18525; AD 2016-10-14]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for certain

Bombardier, Inc. Model CL-600-2C10 (Regional Jet Series 700, 701, & 702) airplanes, Model CL-600-2D15 (Regional Jet Series 705) airplanes, and Model CL-600-2D24 (Regional Jet Series 900) airplanes. This AD was prompted by a report indicating that some operators have inadvertently removed the existing insulation blankets from the upper wing box area. This AD requires inspecting for and replacing missing insulation blankets in the upper wing box area. We are issuing this AD to detect and replace missing insulation blankets from the upper wing box area, which could result in inadequate thermal protection to prevent fuel ignition in the event of an undetected bleed-air leak due to a cracked or ruptured bleed-air duct.

DATES: This AD becomes effective June 30, 2016.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of June 30, 2016.

ADDRESSES: For service information identified in this final rule, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2457.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2457; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT:

Morton Lee, Aerospace Engineer, Propulsion and Services Branch, ANE-173, FAA, New York Aircraft

Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7355; fax 516-794-5531.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Bombardier, Inc. Model CL-600-2C10 (Regional Jet Series 700, 701, & 702) airplanes, Model CL-600-2D15 (Regional Jet Series 705) airplanes, and Model CL-600-2D24 (Regional Jet Series 900) airplanes. The NPRM published in the *Federal Register* on July 7, 2015 (80 FR 38656) (“the NPRM”).

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2014-35, dated October 3, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Bombardier, Inc. Model CL-600-2C10 (Regional Jet Series 700, 701, & 702) airplanes, Model CL-600-2D15 (Regional Jet Series 705) airplanes, and Model CL-600-2D24 (Regional Jet Series 900) airplanes. The MCAI states:

It was discovered that some operators have inadvertently removed the existing insulation blankets from the upper wing box area while incorporating Bombardier Service Bulletin (SB) 670BA-36-016 to comply with [Canadian] AD CF-2012-06 [<http://wwwapps3.tc.gc.ca/Saf-Sec-Sur/2/cawis-swinn/awd-lv-cs1401.asp?rand=>] [which corresponds to FAA AD 2012-12-02, Amendment 39-17081 (77 FR 36129, June 18, 2012)].

Without insulation blankets on the upper wing box area, there may be inadequate thermal protection to prevent fuel ignition in the event of an undetected bleed air leak due to a cracked or ruptured bleed-air duct.

This [Canadian] AD mandates the inspection and rectification [*i.e.*, replacement], as required, of the insulation blankets in the upper wing box area.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2457.

Comments

We gave the public the opportunity to participate in developing this AD. The following presents the comments received on the NPRM and the FAA’s response to each comment.

Request To Revise the Applicability

Bombardier and Endeavor Air requested that we exclude certain airplanes from the applicability.

Bombardier stated that two airplanes, manufacturer serial numbers 15272 and 15279, should not be included in the applicability of the proposed AD, since these two airplanes had Bombardier Service Bulletin 670BA-36-016, Revision A, dated October 11, 2011, incorporated during production by the manufacturer. Therefore, Bombardier stated that those airplanes are not affected by the potential unsafe condition. Bombardier commented that proof of incorporation by Bombardier personnel can be provided to the FAA if required.

Endeavor Air stated that these airplanes accomplished Bombardier Service Bulletin 670BA-36-016, Revision A, dated October 11, 2011, prior to delivery to the operator.

We agree with the commenter’s request for the reasons provided above. We have revised paragraph (c) of this AD accordingly.

Request To Provide Clarification of AD Actions

Endeavor Air stated that the proposed AD would require affected operators to inspect for missing thermal protection blankets using Bombardier Service Bulletin 670BA-57-024 because “. . . some operators have inadvertently removed the existing insulation blanket from the upper wing box area while incorporating Bombardier Service Bulletin 670BA-36-016 to comply with FAA AD 2012-12-02. . . .”

Endeavor Air stated that the FAA did not provide any information why this may have occurred or that the problem is widespread. Endeavor Air also stated that Bombardier Service Bulletin 670BA-36-016 did not include instructions for removing the insulation blankets that were inadvertently removed by some operators. Endeavor Air therefore concluded that the operators or their maintenance provider did not correctly follow the instructions in Bombardier Service Bulletin 670BA-36-016. Endeavor Air stated that it does not agree that the incorrect accomplishment of Bombardier Service Bulletin 670BA-36-016 by some operators should require all affected operators to perform the blanket inspections without a clear explanation why this problem could plausibly exist for all operators.

We agree that clarification is necessary. Bombardier has the service history and data showing a potential widespread problem, and TCCA concurred. Bombardier developed Bombardier Service Bulletin 670BA-57-024 with a different effectivity than that of Bombardier Service Bulletin 670BA-36-016 in order to give credit to

airplanes on which the original blankets were not removed when Bombardier Service Bulletin 670BA-36-016 was incorporated. We have added an option to paragraph (g) of this AD to allow operators to do a records review in lieu of the inspection.

Request To Review Compliance Method

Endeavor Air requested that we review the last sentence in paragraph (g)(2) of the proposed AD. Endeavor Air stated that because the corrective action is to restore an already approved configuration by reinstalling insulation blankets, it believes that the corrective action using “a method acceptable to the Manager, New York Aircraft Certification Office,” rather than “a method approved by the Manager, New York Aircraft Certification Office,” would suffice.

We disagree with the commenter. The word “approved” is part of our standard language for describing methods of compliance in ADs. For a method to be “acceptable,” it must have FAA approval. We have not changed this AD in this regard.

Conclusion

We reviewed the relevant data, considered the comments received, and determined that air safety and the public interest require adopting this AD with the changes described previously and minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

Related Service Information Under 14 CFR Part 51

We reviewed Bombardier Service Bulletin 670BA-57-024, dated July 23, 2014. This service information describes procedures for an inspection of the insulation blankets in the upper wing box area to find if the blankets are installed, and replacement of missing insulation blankets. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

We estimate that this AD affects 470 airplanes of U.S. registry.

We also estimate that it would take about 4 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Required parts would

cost about \$0 per product. Based on these figures, we estimate the cost of this AD on U.S. operators to be \$159,800, or \$340 per product.

In addition, we estimate that any necessary follow-on actions would take up to 70 work-hours and require parts costing up to \$665, for a cost of up to \$6,615 per product. We have no way of determining the number of aircraft that might need this action.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2016-10-14 Bombardier, Inc.: Amendment 39-18525. Docket No. FAA-2015-2457; Directorate Identifier 2014-NM-209-AD.

(a) Effective Date

This AD becomes effective June 30, 2016.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Bombardier, Inc. Model CL-600-2C10 (Regional Jet Series 700, 701, & 702) airplanes, Model CL-600-2D15 (Regional Jet Series 705) airplanes, and Model CL-600-2D24 (Regional Jet Series 900) airplanes, certificated in any category, as identified in Bombardier Service Bulletin 670BA-57-024, dated July 23, 2014; except airplanes having manufacturer serial numbers 15272 and 15279.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Reason

This AD was prompted by a report indicating that some operators have inadvertently removed the existing insulation blankets from the upper wing box area. We are issuing this AD to detect and replace missing insulation blankets from the upper wing box area, which could result in inadequate thermal protection to prevent fuel ignition in the event of an undetected bleed-air leak due to a cracked or ruptured bleed-air duct.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Inspection

Within 800 flight hours or 4 months after the effective date of this AD, whichever occurs first: Do a general visual inspection of the insulation blankets in the upper wing box area to determine whether any insulation blanket is missing in specified areas, in accordance with Part A of the Accomplishment Instructions of Bombardier Service Bulletin 670BA-57-024, dated July 23, 2014. For airplanes on which Bombardier Service Bulletin 670BA-36-016 has been done: A review of airplane maintenance records is acceptable in lieu of this inspection if it can be conclusively determined from that review that the insulation blanket has been reinstalled after

incorporation of Bombardier Service Bulletin 670BA-36-016.

(1) If no insulation blanket is missing, no further action is required by this AD.

(2) If any insulation blanket is missing, within 1,200 flight hours or 6 months after the effective date of this AD, whichever occurs first, replace the missing insulation blankets, in accordance with Part B of the Accomplishment Instructions of Bombardier Service Bulletin 670BA-57-024, dated July 23, 2014; except, where Bombardier Service Bulletin 670BA-57-024, dated July 23, 2014, specifies contacting Bombardier for "an approved disposition to complete this service bulletin," this AD requires corrective action to be done using a method approved by the Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO).

(h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO, ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or TCCA; or Bombardier, Inc.'s TCCA DAO. If approved by the DAO, the approval must include the DAO-authorized signature.

(i) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2014-35, dated October 3, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2457.

(j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Service Bulletin 670BA-57-024, dated July 23, 2014.

(ii) Reserved.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on May 12, 2016.

Suzanne Masterson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-11932 Filed 5-25-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2015-8430; Directorate Identifier 2015-NM-093-AD; Amendment 39-18523; AD 2016-10-12]

RIN 2120-AA64

Airworthiness Directives; Fokker Services B.V. Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. This AD was prompted by accomplishment of a taxi-out checklist which revealed that the elevator movement was partially obstructed due to rotation of the flight control lock adjuster bracket. This AD requires a one-time inspection of the elevator tension control regulator for discrepancies, and corrective actions if necessary. We are issuing this AD to detect and correct discrepancies of the elevator tension control regulators. Such a condition could result in jamming of the elevator mechanism and consequent reduced controllability of the airplane. **DATES:** This AD is effective June 30, 2016.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of June 30, 2016.

ADDRESSES: For service information identified in this final rule, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88-6280-350; fax +31 (0)88-6280-111; email technicalservices@fokker.com; Internet <http://www.myfokkerfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-8430.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-8430; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. The NPRM published in the **Federal Register** on January 13, 2016 (81 FR 1565) ("the NPRM").

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2015-0091, dated May 26, 2015 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. The MCAI states: