

incorporation of Bombardier Service Bulletin 670BA-36-016.

(1) If no insulation blanket is missing, no further action is required by this AD.

(2) If any insulation blanket is missing, within 1,200 flight hours or 6 months after the effective date of this AD, whichever occurs first, replace the missing insulation blankets, in accordance with Part B of the Accomplishment Instructions of Bombardier Service Bulletin 670BA-57-024, dated July 23, 2014; except, where Bombardier Service Bulletin 670BA-57-024, dated July 23, 2014, specifies contacting Bombardier for "an approved disposition to complete this service bulletin," this AD requires corrective action to be done using a method approved by the Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO).

#### (h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO, ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or TCCA; or Bombardier, Inc.'s TCCA DAO. If approved by the DAO, the approval must include the DAO-authorized signature.

#### (i) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2014-35, dated October 3, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2457.

#### (j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Service Bulletin 670BA-57-024, dated July 23, 2014.

(ii) Reserved.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on May 12, 2016.

#### Suzanne Masterson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-11932 Filed 5-25-16; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2015-8430; Directorate Identifier 2015-NM-093-AD; Amendment 39-18523; AD 2016-10-12]

RIN 2120-AA64

#### Airworthiness Directives; Fokker Services B.V. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. This AD was prompted by accomplishment of a taxi-out checklist which revealed that the elevator movement was partially obstructed due to rotation of the flight control lock adjuster bracket. This AD requires a one-time inspection of the elevator tension control regulator for discrepancies, and corrective actions if necessary. We are issuing this AD to detect and correct discrepancies of the elevator tension control regulators. Such a condition could result in jamming of the elevator mechanism and consequent reduced controllability of the airplane. **DATES:** This AD is effective June 30, 2016.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of June 30, 2016.

**ADDRESSES:** For service information identified in this final rule, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88-6280-350; fax +31 (0)88-6280-111; email [technicalservices@fokker.com](mailto:technicalservices@fokker.com); Internet <http://www.myfokkerfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-8430.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-8430; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. The NPRM published in the **Federal Register** on January 13, 2016 (81 FR 1565) ("the NPRM").

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2015-0091, dated May 26, 2015 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. The MCAI states:

During the accomplishment of the taxi-out checklist on an F28 Mark 0100 aeroplane, the flight crew noticed that the elevator movement was partially obstructed. The subsequent investigation revealed that this was due to rotation of the flight control lock adjuster bracket, which had come loose from the elevator tension control regulator. Two of the three attachment bolts were found broken, and two nuts were missing. Although no root cause could be identified for the absence of these nuts, they are considered as the main contributor to the occurrence.

This condition, if not detected and corrected, could lead to jamming of the elevator mechanism, possibly resulting in reduced control of the aeroplane.

To address this potential unsafe condition, Fokker Services published Service Bulletin (SB) SBF 100–27–095, which provides instructions to detect and correct any discrepancies, and to re-install missing or broken parts (if any).

For the reasons described above, this [EASA] AD requires a one-time inspection of the elevator tension control regulator and, depending on findings, accomplishment of applicable corrective action(s).

More information on this subject can be found in Fokker Services All Operators Message AOF100–198.

Discrepancies include loose control lock adjuster brackets, broken bracket attachment bolts, and missing nuts. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–8430.

#### Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM or on the determination of the cost to the public.

#### Conclusion

We reviewed the available data and determined that air safety and the public interest require adopting this AD as proposed, except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

#### Related Service Information Under 14 CFR Part 51

Fokker Services B.V. has issued Fokker Service Bulletin SBF100–27–095, dated April 22, 2015. The service information describes procedures for a one-time inspection of the elevator tension control regulator for discrepancies, and corrective actions. This service information is reasonably available because the interested parties have access to it through their normal

course of business or by the means identified in the **ADDRESSES** section.

#### Costs of Compliance

We estimate that this AD affects 8 airplanes of U.S. registry.

We also estimate that it takes 1 work-hour per product to do the inspection in this AD, and 1 work-hour per product to report inspection findings. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this AD on U.S. operators to be \$1,360, or \$170 per product.

We have received no definitive data that will enable us to provide cost estimates for the on-condition actions specified in this AD.

#### Paperwork Reduction Act

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this AD is 2120–0056. The paperwork cost associated with this AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at 800 Independence Ave. SW., Washington, DC 20591, ATTN: Information Collection Clearance Officer, AES–200.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on

products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

#### 2016–10–12 Fokker Services B.V.:

Amendment 39–18523. Docket No. FAA–2015–8430; Directorate Identifier 2015–NM–093–AD.

#### (a) Effective Date

This AD is effective June 30, 2016.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes, certificated in any category, all serial numbers.

#### (d) Subject

Air Transport Association (ATA) of America Code 27, Flight controls.

**(e) Reason**

This AD was prompted by accomplishment of a taxi-out checklist which revealed that the elevator movement was partially obstructed due to rotation of the flight control lock adjuster bracket. We are issuing this AD to detect and correct discrepancies of the elevator tension control regulators. Such a condition could result in jamming of the elevator mechanism and consequent reduced controllability of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspection/Corrective Actions**

At the next scheduled opening of access panels 346AB or 346BL after the effective date of this AD, but no later than 5,000 flight hours after the effective date of this AD: Do a one-time detailed inspection of the elevator tension control regulator for discrepancies, in accordance with the Accomplishment Instructions of Fokker Service Bulletin SBF100-27-095, dated April 22, 2015. If the flight control lock adjuster bracket is found loose, any bracket attachment bolt is found broken, or any nut is missing, before further flight, do all applicable corrective actions in accordance with the Accomplishment Instructions of Fokker Service Bulletin SBF100-27-095, dated April 22, 2015.

**(h) Reporting Requirement**

Submit a report of any positive findings during any inspection required by paragraph (g) of this AD to Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone: +31 (0)88-6280-350; fax: +31 (0)88-6280-111; email: [technicalservices@fokker.com](mailto:technicalservices@fokker.com); Internet <http://www.myfokkerfleet.com>.

(1) For airplanes on which the inspection specified in paragraph (g) of this AD is accomplished on or after the effective date of this AD: Submit the report within 30 days after performing the inspection.

(2) For airplanes on which the inspection specified in paragraph (g) of this AD is accomplished before the effective date of this AD: Submit the report within 30 days after the effective date of this AD.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-227-1137; fax: 425-227-1149. Information may be emailed to: 9-

ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Fokker B.V. Service's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Reporting Requirements*: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

**(j) Related Information**

Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2015-0091, dated May 26, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-8430.

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Fokker Service Bulletin SBF100-27-095, dated April 22, 2015.

(ii) Reserved.

(3) For service information identified in this AD, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88-6280-350; fax +31 (0)88-6280-111; email [technicalservices@fokker.com](mailto:technicalservices@fokker.com); Internet <http://www.myfokkerfleet.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on May 11, 2016.

**Suzanne Masterson,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-11930 Filed 5-25-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2015-4815; Directorate Identifier 2015-NM-112-AD; Amendment 39-18522; AD 2016-10-11]

RIN 2120-AA64

**Airworthiness Directives; Airbus Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are superseding Airworthiness Directive (AD) 2015-03-06 for all Airbus Model A330-200, A330-200 Freighter, A330-300, A340-200, A340-300, A340-500, and A340-600 series airplanes. AD 2015-03-06 required repetitive inspections of the left-hand (LH) and right-hand (RH) wing main landing gear (MLG) rib 6 aft bearing lugs (forward and aft) to detect any cracks on the two lugs, and replacement if necessary. This new AD requires reduction of certain compliance times. This AD was prompted by reports of additional cracking of the MLG rib 6 aft bearing lugs. We are issuing this AD to detect and correct cracking of the MLG rib 6 aft bearing lugs, which could result in collapse of the MLG upon landing.

**DATES:** This AD is effective June 30, 2016.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of June 30, 2016.

The Director of the Federal Register approved the incorporation by reference of certain other publications listed in this AD as of March 25, 2015 (80 FR 8511, February 18, 2015).

**ADDRESSES:** For service information identified in this final rule, contact