

(ii) As of July 14, 2016 (the effective date of this AD), only install an elevator bellcrank that has been painted as specified in paragraph (f)(2)(i) of this AD and that has been properly oriented to make sure it is not being installed backward.

#### (g) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Jim Rutherford, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4165; fax: (816) 329-4090; email: [jim.rutherford@faa.gov](mailto:jim.rutherford@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

#### (h) Related Information

Refer to MCAI Civil Aviation Authority AD CAA-AD-4-099/98, dated December 30, 1998, for related information. The MCAI can be found in the AD docket on the Internet at: <https://www.regulations.gov/#!documentDetail;D=FAA-2016-4233-0003>.

#### (i) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(3) The following service information was approved for IBR on November 8, 1999 (64 FR 50440, September 17, 1999).

(i) LET Mandatory Bulletin MB No.: L13/082a, dated December 10, 1998.

(ii) Reserved.

(4) For service information identified in this AD, contact BLANIK LIMITED, 2nd Floor Beaux Lane House, Mercer Street Lower, Dublin 2, Republic of Ireland; phone: +420 733 662 194; email: [info@blanik.aero](mailto:info@blanik.aero); Internet: [http://www.blanik.aero/%EF%BB%BFcustomer\\_support](http://www.blanik.aero/%EF%BB%BFcustomer_support).

(5) You may view this service information at FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. In addition, you can access this service information on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-4233.

(6) You may view this service information that is incorporated by reference at the National Archives and Records

Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on May 20, 2016.

**Pat Mullen,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-12591 Filed 6-8-16; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2016-4230; Directorate Identifier 2015-CE-041-AD; Amendment 39-18539; AD 2016-11-12]**

**RIN 2120-AA64**

#### **Airworthiness Directives; EVEKTOR, spol. s.r.o. Gliders**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are superseding airworthiness directive (AD) 2000-20-12 for EVEKTOR, spol. s.r.o. Models L 13 SEH VIVAT and L 13 SDM VIVAT gliders (type certificate previously held by AEROTECHNIK s.r.o.). This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as insufficient material strength of the tail-fuselage attachment fitting. We are issuing this AD to require actions to address the unsafe condition on these products.

**DATES:** This AD is effective July 14, 2016.

The Director of the Federal Register approved the incorporation by reference of a certain other publication listed in this AD as of November 27, 2000 (65 FR 61262, October 17, 2000).

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-4230; or in person at the Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

For service information identified in this AD, contact EVEKTOR, spol. s.r.o.,

Letecka 1008, 686 04 Kunovice, Czech Republic; phone: +420 572 537 428; email: [evektor@evektor.cz](mailto:evektor@evektor.cz); Internet: <http://www.evektor.cz/en/sales-and-support>. You may view this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the Internet at <http://www.regulations.gov> by searching for Docket No. FAA-2016-4230.

**FOR FURTHER INFORMATION CONTACT:** Jim Rutherford, Aerospace Engineer, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4165; fax: (816) 329-4090; email: [jim.rutherford@faa.gov](mailto:jim.rutherford@faa.gov).

#### **SUPPLEMENTARY INFORMATION:**

##### **Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to EVEKTOR, spol. s.r.o. Models L 13 SEH VIVAT and L 13 SDM VIVAT gliders. That NPRM was published in the **Federal Register** on March 4, 2016 (81 FR 11465), and proposed to supersede AD 2000-20-12, Amendment 39-11923 (65 FR 61262, October 17, 2000).

The NPRM proposed to correct an unsafe condition for the specified products and was based on mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country. The MCAI states that:

To prevent destruction of tail-fuselage attachment fitting which can lead to loss of control of the sailplane. This destruction could be caused due to lower strength of the material used during production.

The MCAI can be found in the AD docket on the Internet at: <https://www.regulations.gov/#!documentDetail;D=FAA-2016-4230-0003>.

A review of records since issuance of AD 2000-20-12 revealed that the FAA inadvertently did not address this MCAI for the EVEKTOR, spol. s.r.o. Model L 13 SDM VIVAT gliders and the BLANIK LIMITED Model L-13 AC Blanik gliders. This AD supersedes AD 2000-20-12 to add the EVEKTOR, spol. s.r.o. Model L 13 SDM VIVAT gliders to the applicability of the AD.

The FAA is addressing the BLANIK LIMITED Model L-13 AC Blanik gliders in another AD action.

##### **Comments**

We gave the public the opportunity to participate in developing this AD. We

received no comments on the NPRM (81 FR 11465, March 4, 2016) or on the determination of the cost to the public.

### Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed except for minor editorial changes. We identified that we inadvertently included a parts cost for the initial inspection in the NPRM (81 FR 11465, March 4, 2016), and we removed that parts cost from this final rule AD action. The basic estimated cost for U.S. operators remains the same. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (81 FR 11465, March 4, 2016) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (81 FR 11465, March 4, 2016).

### Related Service Information Under 1 CFR Part 51

AEROTECHNIK CZ s.r.o. issued Mandatory Service Bulletin SEH 13-005a, dated November 18, 1999. The service information describes procedures for testing the material strength of attachment fitting part number A 102 021N and instructions for contacting the manufacturer for replacement information if necessary. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section of the AD.

### Costs of Compliance

We estimate that this AD will affect 9 products of U.S. registry. We also estimate that it would take about 4 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of the AD on U.S. operators to be \$3,060, or \$340 per product.

In addition, we estimate that any necessary follow-on actions would take about 16 work-hours and require parts costing \$500, for a cost of \$1,860 per product. We have no way of determining the number of products that may need these actions.

According to the manufacturer, some of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we

have included all costs in our cost estimate.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-4230; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section.

Comments will be available in the AD docket shortly after receipt.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by removing Amendment 39-11923 (65 FR 61262; October 17, 2000) and adding the following new AD:

#### 2016-11-12 EVEKTOR, spol. s.r.o.:

Amendment 39-18539; Docket No. FAA-2016-4230; Directorate Identifier 2015-CE-041-AD.

#### (a) Effective Date

This airworthiness directive (AD) becomes effective July 14, 2016.

#### (b) Affected ADs

This AD supersedes AD 2000-20-12, Amendment 39-11923 (65 FR 61262; October 17, 2000) ("AD 2000-20-12").

#### (c) Applicability

This AD applies to EVEKTOR, spol. s.r.o. Models L 13 SEH VIVAT and L 13 SDM VIVAT gliders (type certificate previously held by AEROTECHNIK s.r.o.), all serial numbers, certificated in any category.

#### (d) Subject

Air Transport Association of America (ATA) Code 53: Fuselage.

#### (e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as insufficient material strength of the tail-fuselage attachment fitting. We are issuing this proposed AD to detect and correct tail-fuselage fittings with insufficient material strength, which if left uncorrected could result in detachment of the tail from the fuselage with consequent loss of control.

#### (f) Actions and Compliance

Unless already done, do the following actions in paragraphs (f)(1) and (f)(2) of this AD, including all subparagraphs:

- (1) *Model L 13 SEH VIVAT gliders:*
  - (i) Within the next 60 days after November 27, 2000 (the effective date retained from AD 2000-20-12), inspect the tail-fuselage

attachment fitting, part number (P/N) A 102 021N, for damage and material hardness following the procedures in AEROTECHNIK CZ s.r.o. Mandatory Service Bulletin SEH 13-005a, dated November 18, 1999.

(ii) If you find the tail-fuselage attachment fitting is damaged or the material does not meet the hardness requirements specified in the service bulletin during the inspection required in paragraph (f)(1)(i) of this AD, before further flight, you must contact the manufacturer to obtain an FAA-approved replacement part for P/N A 102 021N and FAA-approved installation instructions and install the replacement part. Use the contact information found in paragraph (i)(4) to contact the manufacturer.

(iii) As of November 27, 2000 (the effective date retained from AD 2000-20-12), do not install, on any glider, a P/N A 102 021N attachment fitting that has not passed the inspection required in paragraph (f)(1)(i) of this AD.

(2) *Model L 13 SDM VIVAT gliders:*

(i) Within the next 60 days after July 14, 2016 (the effective date of this AD), inspect the tail-fuselage attachment fitting, P/N A 102 021N, for damage and material hardness following the procedures in AEROTECHNIK CZ s.r.o. Mandatory Service Bulletin SEH 13-005a, dated November 18, 1999.

(ii) If you find the tail-fuselage attachment fitting is damaged or the material does not meet the hardness requirements specified in the service bulletin during the inspection required in paragraph (f)(2)(i) of this AD, before further flight, you must contact the manufacturer to obtain an FAA-approved replacement part for P/N A 102 021N and FAA-approved installation instructions and install the replacement part. Use the contact information found in paragraph (i)(4) to contact the manufacturer.

(iii) As of July 14, 2016 (the effective date of this AD), do not install, on any glider, a P/N A 102 021N attachment fitting that has not passed the inspection required in paragraph (f)(2)(i) of this AD.

**(g) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Jim Rutherford, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4165; fax: (816) 329-4090; email: [jim.rutherford@faa.gov](mailto:jim.rutherford@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

**(h) Related Information**

Refer to MCAI Civil Aviation Authority AD CAA-AD-T-112/1999R1, dated November 23, 1999, for related information. The MCAI can be found in the AD docket on the Internet at: <https://www.regulations.gov/#/documentDetail;D=FAA-2016-4230-0003>.

**(i) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(3) The following service information was approved for IBR on November 27, 2000 (65 FR 61262, October 17, 2000).

(i) AEROTECHNIK CZ s.r.o. Mandatory Service Bulletin SEH 13-005a, dated November 18, 1999.

(ii) Reserved.

(4) For service information identified in this AD, contact EVEKTOR, spol. s.r.o., Letecka 1008, 686 04 Kunovice, Czech Republic; phone: +420 572 537 428; email: [evektor@evektor.cz](mailto:evektor@evektor.cz); Internet: <http://www.evektor.cz/en/sales-and-support>.

(5) You may review copies of the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. In addition, you can access this service information on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-4230.

(6) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on May 20, 2016.

**Pat Mullen,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-12601 Filed 6-8-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 71**

[Docket No. FAA-2016-0149; Airspace Docket No. 15-AWA-8]

**RIN 2120-AA66**

**Amendment of Class C Airspace; Billings Logan International Airport, MT**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action amends geographic coordinates of Billings Logan International Airport, Billings, MT, under Class C airspace, due to recent surveys of the airport. This action does not change the boundaries or operating requirements of the airspace.

**DATES:** Effective date 0901 UTC, September 15, 2016. The Director of the Federal Register approves this incorporation by reference action under title 1, Code of Federal Regulations, part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

**ADDRESSES:** FAA Order 7400.9Z, Airspace Designations and Reporting Points and subsequent amendments can be viewed online at <http://www.faa.gov/airtraffic/publications/>. For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington DC, 20591; telephone: (202) 267-8783. The order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.9Z at NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal-register/code\\_of\\_federal-regulations/ibr\\_locations.html](http://www.archives.gov/federal-register/code_of_federal-regulations/ibr_locations.html).

FAA Order 7400.9, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

**FOR FURTHER INFORMATION CONTACT:** Paul Gallant, Airspace Policy Group, Office of Airspace Services, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783.

**SUPPLEMENTARY INFORMATION:**

**Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it updates the geographic coordinates of Billings Logan International Airport, Billings, MT.