

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Sanjay Ralhan, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1405; fax 425-227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov.

(i) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(ii) AMOCs approved previously for AD 2013-20-11 are approved as AMOCs for the corresponding provisions of paragraphs (g) and (h) of this AD.

(2) *Contacting the Manufacturer*: As of the effective date of this AD, for any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (o) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2014-0207, dated September 16, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-8463.

#### (p) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(3) The following service information was approved for IBR on December 2, 2013 (78 FR 64162, October 28, 2013).

(i) Airbus Service Bulletin A320-35-1049, dated June 15, 2011.

(ii) Airbus Service Bulletin A320-35-1053, dated June 15, 2011.

(iii) Airbus Service Bulletin A320-35-1054, dated June 15, 2011.

(iv) Airbus Service Bulletin A320-35-1055, dated June 15, 2011.

(v) Airbus Service Bulletin A320-35-1056, dated June 15, 2011.

(vi) Airbus Service Bulletin A320-35-1057, dated June 15, 2011.

(vii) Airbus Service Bulletin A320-35-1058, dated June 15, 2011.

(4) For service information identified in this AD, contact Airbus, Airworthiness

Office—ELAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone: +33 5 61 93 36 96; fax: +33 5 61 93 44 51; email: [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>.

(5) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(6) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 3, 2016.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-19481 Filed 8-18-16; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2016-8843; Directorate Identifier 2016-NM-113-AD; Amendment 39-18615; AD 2016-17-02]**

**RIN 2120-AA64**

#### **Airworthiness Directives; Dassault Aviation Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Dassault Aviation Model FALCON 900EX and FALCON 2000EX airplanes. This AD requires revising the airplane flight manual (AFM) to include procedures to follow when an airplane is operating in icing conditions. This AD also provides optional terminating action for the AFM revision. This AD was prompted by a design review of in-production airplanes that identified a deficiency in certain wing anti-ice system ducting. A deficiency in the wing anti-ice system ducting could lead to undetected, reduced performance of the wing anti-ice system, with potential ice accretion and ingestion, possibly resulting in degraded engine power and degraded handling characteristics of the airplane. We are issuing this AD to ensure the flight crew has procedures for operating an airplane in icing conditions.

**DATES:** This AD becomes effective September 6, 2016.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of September 6, 2016.

We must receive comments on this AD by October 3, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this final rule, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-8843.

#### **Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-8843; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149.

**SUPPLEMENTARY INFORMATION:****Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Emergency Airworthiness Directive 2016-0130-E, dated July 5, 2016 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Dassault Aviation Model FALCON 900EX and FALCON 2000EX airplanes. The MCAI states:

A design review of in production aeroplanes identified a manufacturing deficiency of some wing anti-ice system ducting.

This condition, if not detected and corrected, could lead to an undetected reduced performance of the wing anti-ice system, with potential ice accretion and ingestion, possibly resulting in degraded engine power and degraded handling characteristics.

The Falcon 900EX EASY and Falcon \* \* \* [2000EX] Aircraft Flight Manuals (AFM) contain a normal procedure 4-200-05A, “Operations in Icing Conditions”, addressing minimum fan speed rotation (N1) during combined operation of wing anti-ice and engine anti-ice systems. The subsequent investigation demonstrated that the wing anti-ice system performance for aeroplanes equipped with ducting affected by the manufacturing deficiency can be restored increasing N1 value. In addition, Dassault Aviation published Service Bulletin (SB) F900EX-464 (for Falcon 900EX aeroplanes) and SB F2000EX-393 (for Falcon 2000EX aeroplanes), providing instructions for wing anti-ice system ducting inspection.

For the reasons described above, this [EASA] AD requires an AFM amendment and a one-time inspection of the wing anti-ice system ducting and, depending on findings, re-identification or replacement of the wing anti-ice system ducting.

You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-8843.

**Interim Action**

We consider this AD interim action. We are currently considering requiring a detailed inspection of the wing anti-icing system ducting for the presence of a diaphragm and, as applicable, re-identification or replacement of the wing anti-icing system ducting (these actions are required by the MCAI). That inspection and applicable corrective actions would terminate the AFM revision required by this AD action. However, the planned compliance time for the detailed inspection would allow enough time to provide notice and opportunity for prior public comment on the merits of the inspection.

**Related Service Information Under 1 CFR Part 51**

Dassault has issued Service Bulletin F900EX-464, dated June 20, 2016; and Service Bulletin F2000EX-393, dated June 20, 2016. The service information describes procedures for an inspection of the wing anti-ice system ducting and re-identification or replacement of the wing anti-ice system ducting. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**FAA’s Determination and Requirements of This AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are issuing this AD because we evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of these same type designs.

**FAA’s Determination of the Effective Date**

An unsafe condition exists that requires the immediate adoption of this AD. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because a design review of in-production airplanes identified a deficiency in certain wing anti-ice system ducting that could lead to undetected, reduced performance of the wing anti-ice system, with potential ice accretion and ingestion, possibly resulting in degraded engine power and degraded handling characteristics of the airplane. Therefore, we determined that notice and opportunity for public comment before issuing this AD are impracticable and that good cause exists for making this amendment effective in fewer than 30 days.

**Comments Invited**

This AD is a final rule that involves requirements affecting flight safety, and we did not precede it by notice and opportunity for public comment. We invite you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2016-8843; Directorate Identifier 2016-NM-113-AD” at the beginning of your comments. We specifically invite comments on the

overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

**Costs of Compliance**

We estimate that this AD affects 52 airplanes of U.S. registry.

We also estimate that it will take about 1 work-hour per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this AD on U.S. operators to be \$4,420, or \$85 per product.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);

3. Will not affect intrastate aviation in Alaska; and

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2016–17–02 Dassault Aviation:**  
Amendment 39–18615; Docket No. FAA–2016–8843; Directorate Identifier 2016–NM–113–AD.

#### (a) Effective Date

This AD becomes effective September 6, 2016.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to the Dassault Aviation airplanes identified in paragraphs (c)(1) and (c)(2) of this AD, certificated in any category.

(1) Model FALCON 900EX airplanes, serial numbers (S/Ns) 270 through 291 inclusive and 294.

(2) Model FALCON 2000EX airplanes, S/Ns 263 through 305 inclusive, 307 through 313 inclusive, 315, 320, and 701 through 734 inclusive.

#### (d) Subject

Air Transport Association (ATA) of America Code 30, Ice and Rain Protection.

#### (e) Reason

This AD was prompted by a design review of in-production airplanes that identified a deficiency in certain wing anti-ice system ducting. A deficiency in the wing anti-ice

system ducting could lead to undetected, reduced performance of the wing anti-ice system, with potential ice accretion and ingestion, possibly resulting in degraded engine power and degraded handling characteristics of the airplane. We are issuing this AD to ensure the flight crew has procedures for operating an airplane in icing conditions.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Revision to Airplane Flight Manual (AFM)

(1) For Model FALCON 900EX airplanes on which the actions specified in Dassault Service Bulletin F900EX–464 have not been accomplished: Within 10 flight cycles after the effective date of this AD, revise Section 4–200–05A, “OPERATION IN ICING CONDITIONS,” of the Model FALCON 900EX AFM to include the information in figure 1 to paragraph (g)(1) of this AD, and thereafter operate the airplane accordingly. The AFM revision may be done by inserting a copy of this AD into the AFM.

**Figure 1 to Paragraph (g)(1) of this AD – Operation in Icing Conditions**

**Wing Anti-Ice System Operation**

During in flight operation of a wing anti-ice system (WING ANTI-ICE) maintain the N1 of all engines equal to or more than the values defined in Table 1, as applicable to atmospheric condition.

Table 1

New Minimum N1 values required during in flight operation of a wing anti-ice system

Three operative engines:

TAT	- 30 to - 20 °C	- 20 to - 10 °C	- 10 to 0 °C	0 to + 10 °C
Above 20,000 ft	79 %	75%	71%	66%
From 20,000 ft to 10,000 ft	76 %	73%	66%	59%
Below 10,000 ft	68 %	66%	61%	58%

These new values include 3% increase compared to former values (4-200-05A page 1/2).

Two operative engines:

TAT	- 30 to - 20 °C	- 20 to - 10 °C	- 10 to 0 °C	0 to + 10 °C
Above 20,000 ft	86 %	82%	78%	73%
From 20,000 ft to 10,000 ft	83 %	80%	73%	66%
Below 10,000 ft	75 %	73%	68%	65%

These new values include 3% increase compared to former values (4-200-05A page 1/2).

**TAT** – Total Air Temperature

**Note 1:** Maintaining the N1 above the minimum anti-ice N1 on all engines may lead to exceedance of approach speed. Early approach or landing configuration of an airplane and/or application of airbrakes may be used to control the airspeed. In approach and landing and for a limited duration up to three minutes, selection of N1 speeds below the minimum anti-ice N1 speed is authorized. In this case it is necessary to disengage the autothrottle.

**Effectivity:** F900EX (LX variant) S/Ns 270 through 291 inclusive and 294, without Dassault SB F900EX-464.

(2) For Model FALCON 2000EX airplanes on which the actions specified in Dassault Service Bulletin F2000EX-393 have not been accomplished: Within 10 flight cycles after

the effective date of this AD, revise Section 4-200-05A, "OPERATION IN ICING CONDITIONS," of the Model FALCON 2000EX AFM to include the information in

figure 2 to paragraph (g)(2) of this AD, and thereafter operate the airplane accordingly. The AFM revision may be done by inserting a copy of this AD into the AFM.

**Figure 2 to Paragraph (g)(2) of this AD – Operation in Icing Conditions****Wing Anti-Ice System Operation**

During in flight operation of a wing anti-ice system (WING ANTI-ICE) maintain the N1 of both engines equal to or more than the values defined in Table 1, as applicable to atmospheric condition.

Table 1

New Minimum N1 values required during in flight operation of a wing anti-ice system

Two engines operative minimum N1:

<b>Z</b> \ <b>TAT</b>	<b>-30 °C</b>	<b>-15 °C</b>	<b>0 °C</b>	<b>+10 °C</b>
31,000 ft	74.6	67.6	52.8	52.8
22,000 ft	72.4	63.7	52.8	52.1
3,000 ft	57.3	54.9	49.4	48.8
0 ft	54.9	54.9	49.4	48.8

These new values include 2% increase compared to former values (4-200-05A page 1/2).

One engine operative or one bleed inoperative minimum N1:

<b>Z</b> \ <b>TAT</b>	<b>-30 °C</b>	<b>-15 °C</b>	<b>0 °C</b>	<b>+10 °C</b>
31,000 ft	82.4	77.0	64.0	58.0
22,000 ft	79.2	72.0	59.8	56.6
3,000 ft	71.2	66.4	59.8	49.3
0 ft	64.2	63.7	59.8	49.3

These new values include 2% increase compared to former values (4-200-05A page 1/2).

**TAT** – Total Air Temperature

**Z** - Altitude

**Note 1:** Maintaining the N1 above the minimum anti-ice N1 on all engines may lead to exceedance of approach speed. Early approach or landing configuration of an aeroplane and/or application of airbrakes may be used to control the airspeed. In approach and landing and for a limited duration up to three minutes, selection of N1 speeds below the minimum anti-ice N1 speed is authorized. In this case it is necessary to disengage the autothrottle.

**Effectivity:** F2000EX (LXS/S variants) S/Ns 263 through 305 inclusive, 307 through 313 inclusive, 315, 320, and 701 through 734 inclusive, without Dassault SB F2000EX-393.

**(h) Optional Action(s)**

A detailed inspection of the wing anti-ice system ducting for the presence of a diaphragm and, as applicable, a check of the part number, and re-identification of the wing anti-ice system ducting or replacement of the wing anti-ice system ducting, in accordance with the Accomplishment Instructions of Dassault Service Bulletin F900EX-464, dated June 20, 2016; or Service

Bulletin F2000EX-393, dated June 20, 2016; as applicable; terminates the requirements of paragraph (g) of this AD for that airplane only. After the applicable actions in the service information have been completed, the AFM revision required by paragraph (g) of this AD may be removed from the AFM for that airplane.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your

request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Dassault Aviation's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (j) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) Emergency Airworthiness Directive 2016-0130-E, dated July 5, 2016, for related information. You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-8843.

#### (k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Dassault Service Bulletin F900EX-464, dated June 20, 2016.

(ii) Dassault Service Bulletin F2000EX-393, dated June 20, 2016.

(3) For service information identified in this AD, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 5, 2016.

**Chris L. Spangenberg,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-19484 Filed 8-18-16; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

**[Docket No. FAA-2016-8926; Amendment No. 71-48]**

**RIN 2120-AA66**

#### Airspace Designations; Incorporation by Reference

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action amends Title 14 Code of Federal Regulations (14 CFR) part 71 relating to airspace designations to reflect the approval by the Director of the Federal Register of the incorporation by reference of FAA Order 7400.11A, Airspace Designations and Reporting Points. This action also explains the procedures the FAA will use to amend the listings of Class A, B, C, D, and E airspace areas; air traffic service routes; and reporting points incorporated by reference.

**DATES:** These regulations are effective September 15, 2016, through September 15, 2017. The incorporation by reference of FAA Order 7400.11A is approved by the Director of the Federal Register as of September 15, 2016, through September 15, 2017.

**ADDRESSES:** FAA Order 7400.11A, Airspace Designations and Reporting Points, and subsequent amendments can be viewed on line at [http://www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11A at NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal-regulations/ibr-locations.html](http://www.archives.gov/federal_register/code_of_federal-regulations/ibr-locations.html).

FAA Order 7400.11, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

#### FOR FURTHER INFORMATION CONTACT:

Sarah A. Combs, Airspace Policy Group, Office of Airspace Services, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783.

#### SUPPLEMENTARY INFORMATION:

##### History

FAA Order 7400.9Z, Airspace Designations and Reporting Points, effective September 15, 2015, listed Class A, B, C, D and E airspace areas; air traffic service routes; and reporting points. Due to the length of these descriptions, the FAA requested approval from the Office of the Federal Register to incorporate the material by reference in the Federal Aviation Regulations section 71.1, effective September 15, 2015, through September 15, 2016. During the incorporation by reference period, the FAA processed all proposed changes of the airspace listings in FAA Order 7400.9Z in full text as proposed rule documents in the **Federal Register**. Likewise, all amendments of these listings were published in full text as final rules in the **Federal Register**. This rule reflects the periodic integration of these final rule amendments into a revised edition of Order 7400.11A, Airspace Designations and Reporting Points. The Director of the Federal Register has approved the incorporation by reference of FAA Order 7400.11A in section 71.1, as of September 15, 2016, through September 15, 2017. This rule also explains the procedures the FAA will use to amend the airspace designations incorporated by reference in part 71. Sections 71.5, 71.15, 71.31, 71.33, 71.41, 71.51, 71.61, 71.71, and 71.901 are also updated to reflect the incorporation by reference of FAA Order 7400.11A.

#### Availability and Summary of Documents for Incorporation by Reference

This document incorporates by reference FAA Order 7400.11A, Airspace Designations and Reporting Points, dated August 3, 2016, and effective September 15, 2016, in section 71.1. FAA Order 7400.11A is publicly available as listed in the **ADDRESSES** section of this final rule. FAA Order 7400.11A lists Class A, B, C, D, and E airspace areas, air traffic service routes, and reporting points.

#### The Rule

This action amends Title 14 Code of Federal Regulations (14 CFR) part 71 to reflect the approval by the Director of the Federal Register of the incorporation by reference of FAA Order 7400.11A,