

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Saab AB, Saab Aeronautics (formerly known as Saab AB, Saab Aerosystems):** Docket No. FAA-2016-9056; Directorate Identifier 2016-NM-007-AD.

#### (a) Comments Due Date

We must receive comments by October 24, 2016.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to certain Saab AB, Saab Aeronautics (formerly known as Saab AB, Saab Aerosystems) Model SAAB 2000 airplanes, certificated in any category, serial numbers 017, 019 through 021 inclusive, 027 through 028 inclusive, 030, 034, 040, 050, and 052.

#### (d) Subject

Air Transport Association (ATA) of America Code 38, Water/waste.

#### (e) Reason

This AD was prompted by an occurrence that was reported of rudder pedal restriction on a SAAB Model 2000 airplane with the large potable water system (LPWS) installed, equipped with in-line heaters. We are issuing this AD to prevent water spray in case of a failed pipe or coupling during water filling on the ground. This condition, if not corrected, could freeze parts of the flight control system, possibly resulting in reduced control of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Repair of Basic Potable Water System (BPWS)

Within 24 months after the effective date of this AD, install shrinkable tubes on the water piping of the BPWS, in accordance with the Accomplishment Instructions of SAAB Service Bulletin 2000-38-012, dated August 20, 2015.

#### (h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Branch Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch/ACO, send it to ATTN: Sharam Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1112; fax 425-227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using

any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Saab AB, Saab Aerosystems' EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (i) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2016-0013, dated January 14, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9056.

(2) For service information identified in this AD, contact Saab AB, Saab Aeronautics, SE-581 88, Linköping, Sweden; telephone +46 13 18 5591; fax +46 13 18 4874; email [saab2000.techsupport@saabgroup.com](mailto:saab2000.techsupport@saabgroup.com); Internet <http://www.saabgroup.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on August 24, 2016.

**John P. Piccola, Jr.,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-21165 Filed 9-7-16; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2016-9055; Directorate Identifier 2016-NM-071-AD]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A300 B4-600R series airplanes, Model A300 C4-605R Variant F airplanes, and Model A300 F4-600R series airplanes. This proposed AD was prompted by the results of a full stress analysis of the lower area of a certain

frame that revealed a crack could occur in the forward fitting lower radius of a certain frame after a certain number of flight cycles. This proposed AD would require an inspection of the lower area of a certain frame radius for cracking, and corrective action if necessary. We are proposing this AD to detect and correct cracking in the forward fitting lower radius of a certain frame. Such cracking could reduce the structural integrity of the fuselage.

**DATES:** We must receive comments on this proposed AD by October 24, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- Fax: 202-493-2251.
- Mail: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9055; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will

be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-2125; fax 425-227-1149.

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2016-9055; Directorate Identifier 2016-NM-071-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2016-0085, dated April 28, 2016 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Airbus Model A300 B4-600R series airplanes, Model A300 C4-605R Variant F airplanes, and Airbus Model A300 F4-600R series airplanes. The MCAI states:

Following a recently completed full stress analysis of the Frame (FR) 40 lower area, supported by a Finite Element Model (FEM), of the post-mod 10221 configuration, it was demonstrated that for the FR40 forward fitting lower radius, a crack could occur after a certain amount of flight cycles (FC).

This condition, if not detected and corrected, could reduce the structural integrity of the fuselage.

To address this potential unsafe condition, Airbus established that crack detection could be performed through a special detail inspection (SDI) using a high frequency eddy current (HFEC) method, and issued Alert Operators Transmission (AOT) A57W009-16.

For the reasons described above, this AD requires a one-time SDI of the FR40 lower area and, depending on findings, accomplishment of applicable corrective action(s).

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9055.

**Related Service Information Under 1 CFR Part 51**

We reviewed Airbus Alert Operators Transmission—AOT A57W009-16, Rev 00, dated February 25, 2016, including Appendixes 1 and 2, both undated. The service information describes procedures for inspecting the forward fitting lower radius of FR40 for cracking and corrective action. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**FAA’s Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of these same type designs.

**Clarification of Applicability**

The MCAI lists Airbus Model A300 B4-622R airplanes twice in the applicability. We have discussed the applicability with EASA, and the second reference was a typographical error which should have been “Airbus Model A300 F4-622R airplanes.” The applicability of this proposed AD will include Airbus Model A300 F4-622R airplanes.

**Costs of Compliance**

We estimate that this proposed AD affects 94 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection .....	3 work-hours × \$85 per hour = \$255 .....	\$0	\$255	\$23,970

ESTIMATED COSTS—Continued

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Reporting .....	1 work-hour × \$85 per hour = \$85 .....	\$0	\$85	\$7,990

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

**Paperwork Reduction Act**

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this proposed AD is 2120–0056. The paperwork cost associated with this proposed AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this proposed AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at 800 Independence Ave. SW., Washington, DC 20591, ATTN: Information Collection Clearance Officer, AES–200.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national

Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA–2016–9055; Directorate Identifier 2016–NM–071–AD.

**(a) Comments Due Date**

We must receive comments by October 24, 2016.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Airbus airplanes, certificated in any category, identified in paragraphs (c)(1), (c)(2), and (c)(3) of this AD, on which Airbus Modification 10221 was embodied in production.

- (1) Airbus Model A300 B4–605R and B4–622R airplanes.
- (2) Airbus Model A300 C4–605R Variant F airplanes.
- (3) Airbus Model A300 F4–605R and F4–622R airplanes.

**(d) Subject**

Air Transport Association (ATA) of America Code 57, Wings.

**(e) Reason**

This AD was prompted by the results of a full stress analysis of the lower area of frame (FR) 40 that revealed a crack could occur in the forward fitting lower radius of FR 40 after a certain number of flight cycles. We are issuing this AD to detect and correct cracking in the forward fitting lower radius of FR 40. Such cracking could reduce the structural integrity of the fuselage.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspection**

At the later of the compliance times specified in paragraphs (g)(1) and (g)(2) of this AD, do a high frequency eddy current inspection of the lower area of the FR 40 radius for cracking, in accordance with the procedures in Airbus Alert Operators Transmission—AOT A57W009–16, Rev 00, dated February 25, 2016, including Appendixes 1 and 2, both undated.

- (1) Prior to exceeding 19,000 total flight cycles or 41,000 flight hours since the airplane’s first flight, whichever occurs first.
- (2) Within 300 flight cycles or 630 flight hours after the effective date of this AD, whichever occurs first.

**(h) Corrective Action**

If any crack is found during the inspection required by paragraph (g) of this AD: Before further flight, repair using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus’s EASA Design Organization Approval (DOA)...//MADGE 2015/Differences/contact\_mfr\_foreign.doc.

**(i) Reporting Requirement**

Submit a report of all findings (both positive and negative) from the inspection required by paragraph (g) of this AD to Airbus Customer Services through TechRequest on Airbus World (<https://w3.airbus.com/>) by selecting Engineering Domain and ATA 57–10.

- (1) For airplanes on which the inspection specified in paragraph (g) of this AD is accomplished on or after the effective date of this AD: Submit the report within 30 days after performing the inspection.
- (2) For airplanes on which the inspection specified in paragraph (g) of this AD is accomplished before the effective date of this AD: Submit the report within 30 days after the effective date of this AD.

**(j) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-2125; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the EASA; or Airbus's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

(3) Reporting Requirements: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

**(k) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2016-0085, dated April 28, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9055.

(2) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the

FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on August 22, 2016.

**John P. Piccola, Jr.,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-21166 Filed 9-7-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2016-9058; Directorate Identifier 2016-NM-024-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Fokker Services B.V.**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD), for certain Fokker Services B.V. Model F28 Mark 0100 airplanes. This proposed AD was prompted by an analysis which determined that, for certain areas of the fuselage, the current threshold of an Airworthiness Limitations Section inspection is insufficient to detect early crack development. This proposed AD would require one time high and low frequency eddy current inspections of the affected fuselage skin for cracks and repair if necessary. We are proposing this AD to detect and correct cracks in the fuselage skin; such cracking could result in reduced structural integrity of the fuselage.

**DATES:** We must receive comments on this proposed AD by October 24, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Fokker Services

B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone: +31 (0)88-6280-350; fax: +31 (0)88-6280-111; email: [technicalservices@fokker.com](mailto:technicalservices@fokker.com); Internet <http://www.myfokkerfleet.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9058; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-9058; Directorate Identifier 2016-NM-024-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive Airworthiness Directive 2016-0029, dated February 23, 2016 (referred