

approved as an AMOC in accordance with the procedures specified in paragraph (k)(1) of this AD.

(k) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to the attention of the person identified in paragraph (l)(2) of this AD. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: As of the effective date of this AD, for any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the Agência Nacional de Aviação Civil (ANAC); or ANAC's authorized Designee. If approved by the ANAC Designee, the approval must include the Designee's authorized signature.

(l) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Brazilian Airworthiness Directive 2016-04-01, effective April 4, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0008.

(2) For more information about this AD, contact Ana Martinez Hueto, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1622; fax 425-227-1320.

(3) For service information identified in this AD, contact Embraer S.A., Technical Publications Section (PC 060), Av. Brigadeiro Faria Lima, 2170—Putim—12227-901 São Jose dos Campos—SP—BRASIL; telephone +55 12 3927-5852 or +55 12 3309-0732; fax +55 12 3927-7546; email distrib@embraer.com.br; Internet <http://www.flyembraer.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on May 8, 2017.

Michael Kaszycki,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2017-10136 Filed 5-19-17; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2017-0477; Directorate Identifier 2016-NM-112-AD]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc., Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc., Model CL-600-2B16 (CL-601-3A, CL-601-3R, and CL-604 Variants) airplanes. This proposed AD was prompted by a report indicating that the lanyard length of the passenger drop down oxygen masks is too long. This proposed AD would require replacing the existing oxygen mask lanyards with lanyards of the correct length. We are proposing this AD to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by July 6, 2017.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax*: 202-493-2251.

- *Mail*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for

and locating Docket No. FAA-2017-0477; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Cesar A. Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7318; fax 516-794-5531.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2017-0477; Directorate Identifier 2016-NM-112-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2016-15, dated June 1, 2016 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Bombardier, Inc., Model CL-600-2B16 (CL-601-3A, CL-601-3R, and CL-604 Variants) airplanes. The MCAI states:

Bombardier (BA) has determined that the lanyard length of the passenger drop down oxygen masks is too long and may cause the safety pin tethered to the opposite end of the lanyard to remain engaged in the oxygen flow mechanism when the mask is pulled to the passenger's face. In an emergency situation where oxygen is required, it is possible that certain passengers may not receive oxygen

supply due to the increased length of the lanyard.

[Bombardier] has issued service bulletin (SB) 605-35-003 to replace the existing lanyards in the passenger oxygen box assemblies with lanyards of the correct length. Incorporation of this [Bombardier service bulletin] will restore the proper oxygen flow functionality to the passenger oxygen masks in the event of an emergency.

This [Canadian] AD mandates the incorporation of [Bombardier service bulletin] 605-35-003.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0477.

Related Service Information Under 1 CFR Part 51

Bombardier, Inc., issued Service Bulletin 605-35-003, Revision 02, dated April 18, 2016. This service information describes procedures for replacing the existing oxygen mask lanyards with lanyards of the correct length. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another

country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

Costs of Compliance

We estimate that this proposed AD affects 120 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replacement	4 work-hours × \$85 per hour = \$340	Not available	\$340	\$40,800

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the

distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

Bombardier, Inc.: Docket No. FAA-2017-0477; Directorate Identifier 2016-NM-112-AD.

(a) Comments Due Date

We must receive comments by July 6, 2017.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Bombardier, Inc., Model CL-600-2B16 (CL-601-3A, CL-601-3R, and CL-604 Variants) airplanes, certificated in any category, serial numbers 5702 through 5705 inclusive, 5707, 5709, 5710, 5712, 5714, 5715, 5718, 5719, 5722, 5723, 5725, 5727, 5728, 5731 through 5733 inclusive, 5735, 5736, 5740, 5742, 5743, 5745, 5746, 5748 through 5750 inclusive, 5752 through 5754 inclusive, 5756 through 5758 inclusive, 5760 through 5762 inclusive, 5764 through 5766 inclusive, 5768 through 5770 inclusive, 5772 through 5774 inclusive, 5776 through 5780 inclusive, 5782 through 5787 inclusive, 5790, 5791, 5793, 5794, 5796, 5797, 5799, 5800, 5802, 5803, 5805 through 5814 inclusive, 5816, 5818 through 5820 inclusive, 5823 through 5829 inclusive, 5831 through 5853 inclusive, 5856, 5857, 5859 through 5863 inclusive, 5865 through 5874 inclusive, 5876 through 5881 inclusive, 5883 through 5888 inclusive, 5890 through 5894 inclusive, 5896 through 5898 inclusive, 5900 through 5906 inclusive, 5908 through 5911 inclusive, 5913 through 5938 inclusive, 5940 through 5947 inclusive, 5949 through 5980 inclusive, 5982 through 5985 inclusive, 5987, and 5988.

(d) Subject

Air Transport Association (ATA) of America Code 35, Oxygen.

(e) Reason

This AD was prompted by a report indicating that the lanyard length of the passenger drop down oxygen mask is too long. The length of the oxygen mask lanyard might cause the safety pin tethered to the opposite end of the lanyard to remain

engaged in the oxygen flow mechanism when the mask is pulled to the passenger's face. We are issuing this AD to prevent improper oxygen flow functionality to the passenger oxygen masks in the event of an emergency.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Replacement of Oxygen Mask Lanyards

Within 2,400 flight hours or 60 months, whichever occurs first after the effective date of this AD, replace the existing lanyards in the passenger oxygen box assemblies with lanyards of the correct length, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 605-35-003, Revision 02, dated April 18, 2016.

(h) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 605-35-003, dated January 28, 2016; or Bombardier Service Bulletin 605-35-003, Revision 01, dated February 10, 2016.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2016-15, dated June 1, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0477.

(2) For more information about this AD, contact Cesar A. Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY

11590; telephone 516-228-7318; fax 516-794-5531.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on May 12, 2017.

Michael Kaszycki,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2017-10137 Filed 5-19-17; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2017-0479; Directorate Identifier 2016-NM-202-AD]

RIN 2120-AA64

Airworthiness Directives; Saab AB, Saab Aeronautics (Formerly Known as Saab AB, Saab Aerosystems) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Saab AB, Saab Aeronautics Model 340A (SAAB/SF340A) airplanes. This proposed AD was prompted by the discovery of circuit breakers of unsuitable strength that fail to protect the system from overcurrent. This proposed AD would require replacing certain circuit breakers. We are proposing this AD to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by July 6, 2017.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Saab AB, Saab Aeronautics, SE-581 88, Linköping, Sweden; telephone +46 13 18 5591; fax +46 13 18 4874; email saab340techsupport@saabgroup.com; Internet <http://www.saabgroup.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0479; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Shahram Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1112; fax 425-227-1149.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2017-0479; Directorate Identifier 2016-NM-202-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.