

accordance with the procedures specified in paragraph (l)(2) of this AD.

**(i) Airplanes Modified per Revision 01 of the Service Information**

For airplanes modified before the effective date of this AD using Airbus Service Bulletin A310-53-2124, Revision 01, dated May 3, 2007: Unless already accomplished, before further flight, do applicable corrective actions using a method approved by the

Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA).

**(j) Additional Inspection and Modification**

Except as provided by paragraphs (j)(1) and (j)(2) of this AD, as applicable: At the applicable thresholds specified in table 3 to the introductory text of paragraph (j) of this

AD, contact the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or EASA; or Airbus's EASA DOA for additional inspection and modification instructions. Accomplish those instructions within the compliance times provided by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or EASA; or Airbus's EASA DOA.

TABLE 3 TO THE INTRODUCTORY TEXT OF PARAGRAPH (J) OF THIS AD—ADDITIONAL INSPECTION AND MODIFICATION

Affected airplanes	Thresholds (Flight cycles or flight hours, whichever occurs first after accomplishment of the inspection and modification specified in Airbus Service Bulletin A310-53-2124)	
	Inspection threshold	Modification threshold
Model A310-203, -204, -221, and -222 airplanes.	30,200 flight cycles or 68,122 flight hours .....	45,500 flight cycles or 102,722 flight hours
Model A310-304, -322, -324, and -325 airplanes.	37,000 flight cycles or 103,522 flight hours .....	55,700 flight cycles or 155,722 flight hours

(1) For Model A310-203, -204, -221, and -222 airplanes: No additional inspection is required if the inspection and modification specified in Airbus Service Bulletin A310-53-2124 was done after the accumulation of 29,500 flight cycles and 70,900 flight hours since the first flight of the airplane.

(2) For Model A310-304, -322, -324, and -325 airplanes: No additional inspection is required if the inspection and modification specified in Airbus Service Bulletin A310-53-2124 was done after the accumulation of 22,600 flight cycles and 69,400 flight hours since the first flight of the airplane.

**(k) Credit for Previous Actions**

This paragraph provides credit for the actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using the Accomplishment Instructions of Airbus Service Bulletin A310-53-2124, dated April 4, 2005; or Airbus Service Bulletin A310-53-2124, Revision 02, dated May 22, 2008.

**(l) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to the attention of the person identified in paragraph (m)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: As of the effective date of this AD, for any requirement in this AD to obtain corrective actions from

a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or EASA; or Airbus's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as provided by paragraph (h) of this AD: If any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

**(m) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2016-0197, dated October 5, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0695.

(2) For more information about this AD, contact Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-227-2125; fax: 425-227-1149.

(3) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone: +33 5 61 93 36 96; fax: +33 5 61 93 44 51; email: [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet: <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For

information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 29, 2017.

**Michael Kaszycki**,  
*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*  
[FR Doc. 2017-14590 Filed 7-13-17; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA-2017-0630; Directorate Identifier 2017-NM-058-AD]

**RIN 2120-AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 777-200, -200LR, -300, and -300ER series airplanes. This proposed AD was prompted by reports of corrosion in the aft fuselage. This proposed AD would require a one-time review of the operator's maintenance procedures, repetitive detailed internal and external inspections for corrosion or cracking, and applicable on-condition actions. This proposed AD would also include an optional terminating action for the inspections. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by August 28, 2017.  
**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0630.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0630; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Eric Lin, Aerospace Engineer, Airframe

Branch, ANM-120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6412; fax: 425-917-6590; email: [eric.lin@faa.gov](mailto:eric.lin@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2017-0630; Directorate Identifier 2017-NM-058-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

We have received reports indicating extensive corrosion was found in the lower left side of the aft fuselage, between station 1790 and station 2033.5, from stringer S-34L to stringer S-49R. On several airplanes, additional corrosion was found after initial repairs were made to adjacent areas. This corrosion was caused by a failure to fully clean and neutralize spills or leaks of acidic or corrosive contents from the vacuum waste system. Vacuum waste system residue on the structure or in insulation blankets becomes reactivated with moisture that develops during flight, causing additional corrosion. Untreated spills can allow the breakdown of protective finishes and accelerate the corrosion reaction rate. This condition, if not corrected, could cause fatigue cracks, which could result in rapid decompression and loss of structural integrity.

**Related Service Information Under 1 CFR Part 51**

We reviewed Boeing Alert Service Bulletin 777-53A0083, dated April 20, 2017. The service information describes procedures for a one-time review of the operator’s maintenance procedures, repetitive detailed internal and external inspections for corrosion or cracking, cleaning and neutralization of the internal inspection area (an optional terminating action), and applicable on-condition actions. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**FAA’s Determination**

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements**

This proposed AD would require accomplishment of the actions identified as “RC” (required for compliance) in the Accomplishment Instructions of Boeing Alert Service Bulletin 777-53A0083, dated April 20, 2017, described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0630.

**Costs of Compliance**

We estimate that this proposed AD affects 161 airplanes of U.S. registry. The cost to review an operator’s maintenance program varies depending on the operator’s recordkeeping system and fleet size. We estimate the following costs to comply with the remaining actions of this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspections .....	75 work-hours × \$85 per hour = \$6,375 per inspection cycle	\$0	\$6,375 per inspection cycle.	\$1,026,375 per inspection cycle

## ESTIMATED COSTS FOR OPTIONAL TERMINATING ACTIONS

Action	Labor cost	Parts cost	Cost per product
Cleaning and neutralization .....	30 work-hours × \$85 per hour = \$2,550 .....	\$0	\$2,550

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a "significant regulatory action" under Executive Order 12866,

(2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**The Boeing Company:** Docket No. FAA–2017–0630; Directorate Identifier 2017–NM–058–AD.

#### (a) Comments Due Date

We must receive comments by August 28, 2017.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to The Boeing Company Model 777–200, –200LR, –300, and –300ER series airplanes, certificated in any category, as identified in Boeing Alert Service Bulletin 777–53A0083, dated April 20, 2017.

#### (d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

#### (e) Unsafe Condition

This AD was prompted by reports of extensive corrosion in the aft fuselage. We are issuing this AD to detect and correct untreated vacuum waste system spills, which could cause corrosion of the airplane structure, which could lead to fatigue cracks, and could ultimately result in rapid decompression and loss of structural integrity.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Required Actions

Except as required by paragraph (h) of this AD: At the applicable times specified in paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 777–53A0083, dated April 20, 2017, do all applicable actions identified as "RC" (required for compliance) in, and in accordance with, the Accomplishment Instructions of Boeing Alert Service Bulletin 777–53A0083, dated April 20, 2017.

#### (h) Exceptions to Service Information Specifications

(1) Where Boeing Alert Service Bulletin 777–53A0083, dated April 20, 2017, uses the phrase "after the original issue date of this service bulletin," for purposes of determining compliance with the requirements of this AD, the phrase "after the effective date of this AD" must be used.

(2) Where Boeing Alert Service Bulletin 777–53A0083, dated April 20, 2017, specifies contacting Boeing, and specifies that action as RC: This AD requires using a method approved in accordance with the procedures specified in paragraph (j) of this AD.

#### (i) Optional Terminating Action for Repetitive Inspections

Accomplishment of "PART 5: CLEANING AND NEUTRALIZATION," as specified in the Accomplishment Instructions of Boeing Alert Service Bulletin 777–53A0083, dated April 20, 2017, terminates the repetitive inspections required by paragraph (g) of this AD.

#### (j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (k)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) Except as required by paragraph (h)(2) of this AD: For service information that contains steps that are labeled as RC, the provisions of paragraphs (j)(4)(i) and (j)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is

labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

#### (k) Related Information

(1) For more information about this AD, contact Eric Lin, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle ACO, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6412; fax: 425-917-6590; email: [eric.lin@faa.gov](mailto:eric.lin@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 29, 2017.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017-14582 Filed 7-13-17; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF HOMELAND SECURITY

### Coast Guard

#### 33 CFR Chapter I

#### 46 CFR Chapters I and III

#### 49 CFR Chapter IV

[Docket No. USCG-2017-0665]

### Towing Safety Advisory Committee— Input To Support Regulatory Reform of Coast Guard Regulations—New Task

**AGENCY:** U.S. Coast Guard, Department of Homeland Security.

**ACTION:** Announcement of new task assignment for the Towing Safety Advisory Committee (TSAC); teleconference meeting.

**SUMMARY:** The U.S. Coast Guard is issuing a new task to the Towing Safety Advisory Committee (TSAC). The U.S. Coast Guard is asking TSAC to help the agency identify existing regulations, guidance, and collections of information (that fall within the scope of the

Committee’s charter) for possible repeal, replacement, or modification. This tasking is in response to the issuance of Executive Orders 13771, “Reducing Regulation and Controlling Regulatory Costs; 13777, “Enforcing the Regulatory Reform Agenda;” and 13783, “Promoting Energy Independence and Economic Growth.” The full Committee is scheduled to meet by teleconference on August 2, 2017, to discuss this tasking. This teleconference will be open to the public. The U.S. Coast Guard will consider TSAC recommendations as part of the process of identifying regulations, guidance, and collections of information to be repealed, replaced, or modified pursuant to the three Executive Orders discussed above.

**DATES:** The full Committee is scheduled to meet by teleconference on August 2, 2017, from 1 p.m. to 2:30 p.m. EDT. Please note that this teleconference may adjourn early if the Committee has completed its business.

**ADDRESSES:** To join the teleconference or to request special accommodations, contact the individual listed in the **FOR FURTHER INFORMATION CONTACT** section no later than 1 p.m. on July 28, 2017. The number of teleconference lines is limited and will be available on a first-come, first-served basis.

**Instructions:** Submit comments on the task statement at any time, including orally at the teleconference, but if you want Committee members to review your comments before the teleconference, please submit your comments no later than July 28, 2017.

You must include the words “Department of Homeland Security” and the docket number for this action. Written comments may also be submitted using the Federal e-Rulemaking Portal at <http://www.regulations.gov>. If you encounter technical difficulties with comment submission, contact the individual listed in the **FOR FURTHER INFORMATION CONTACT** section of this notice. Comments received will be posted without alteration at <http://www.regulations.gov>, including any personal information provided. You may review *Regulations.gov*’s Privacy and Security Notice at <https://www.regulations.gov/privacyNotice>.

**Docket Search:** For access to the docket or to read documents or comments related to this notice, go to <http://www.regulations.gov>, insert “USCG-2017-0665” in the Search box, press Enter, and then click on the item you wish to view.

**FOR FURTHER INFORMATION CONTACT:** Lieutenant Commander William

Nabach, Alternate Designated Federal Officer of the Towing Safety Advisory Committee, telephone (202) 372-1386, or email [william.a.nabach@uscg.mil](mailto:william.a.nabach@uscg.mil).

#### SUPPLEMENTARY INFORMATION:

#### New Task to the Committee

The U.S. Coast Guard is issuing a new task to TSAC to provide recommendations on whether existing regulations, guidance, and information collections (that fall within the scope of the Committee’s charter) should be repealed, replaced, or modified. TSAC will then provide advice and recommendations on the assigned task and submit a final recommendation report to the U.S. Coast Guard.

#### Background

On January 30, 2017, President Trump issued Executive Order 13771, “Reducing Regulation and Controlling Regulatory Costs.” Under that Executive Order, for every one new regulation issued, at least two prior regulations must be identified for elimination, and the cost of planned regulations must be prudently managed and controlled through a budgeting process. On February 24, 2017, the President issued Executive Order 13777, “Enforcing the Regulatory Reform Agenda.” That Executive Order directs agencies to take specific steps to identify and alleviate unnecessary regulatory burdens placed on the American people. On March 28, 2017, the President issued Executive Order 13783, “Promoting Energy Independence and Economic Growth.” Executive Order 13783 promotes the clean and safe development of our Nation’s vast energy resources, while at the same time avoiding agency actions that unnecessarily encumber energy production.

When implementing the regulatory offsets required by Executive Order 13771, each agency head is directed to prioritize, to the extent permitted by law, those regulations that the agency’s Regulatory Reform Task Force identifies as outdated, unnecessary, or ineffective in accordance with Executive Order 13777. As part of this process to comply with all three Executive Orders, the U.S. Coast Guard is reaching out through multiple avenues to interested individuals to gather their input about what regulations, guidance, and information collections, they believe may need to be repealed, replaced, or modified. On June 8, 2017, the U.S. Coast Guard issued a general notice in the **Federal Register** requesting comments from interested individuals regarding their recommendations, 82 FR 26632. In addition to this general solicitation, the U.S. Coast Guard also