

**(b) Affected ADs**

This AD replaces AD 99–23–16, Amendment 39–11412 (64 FR 61485, November 12, 1999) (“AD 99–23–16”).

**(c) Applicability**

This AD applies to Airbus airplanes, certificated in any category, as specified in paragraphs (c)(1) and (c)(2) of this AD.

(1) Model A330–301, A330–321, A330–322, A330–341 and A330–342 airplanes, all manufacturer serial numbers, except those on which Airbus modification 42605 has been embodied in production.

(2) Model A340–211, A340–212, A340–213, A340–311, A340–312, and A340–313 airplanes, all manufacturer serial numbers, except those on which Airbus modification 42605 has been embodied in production.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Reason**

This AD was prompted by a new fatigue and damage tolerance evaluation that concluded that the current inspection thresholds and intervals had to be more restrictive. We are issuing this AD to detect and correct fatigue cracking of the vertical flange of the inboard Z-stiffeners of the centerline panel of the fuselage belly fairing, which could result in reduced structural integrity of the belly fairing.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Within 30 days after the effective date of this AD, request instructions from the Manager, International Section, Transport Standards Branch, FAA, to address the unsafe condition specified in paragraph (e) of this AD; and accomplish the actions at the times specified in, and in accordance with, those instructions. Guidance can be found in Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency (EASA) AD 2013–0241, dated October 1, 2013.

**(h) Alternative Methods of Compliance (AMOCs)**

The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (i)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(i) Related Information**

(1) Refer to MCAI EASA AD 2013–0241, dated October 1, 2013, for related information. You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0302.

(2) For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th Street, Des Moines, WA 98198; telephone and fax: 206–231–3229.

**(j) Material Incorporated by Reference**

None.

Issued in Des Moines, Washington, on April 11, 2018.

**Dionne Palermo,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018–08648 Filed 4–27–18; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA–2017–1248; Product Identifier 2017–NM–162–AD; Amendment 39–19257; AD 2018–09–01]**

**RIN 2120–AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all The Boeing Company Model 737–100, –200, –200C, –300, –400, and –500 series airplanes. This AD was prompted by reports of cracks found in the main landing gear (MLG) beam forward support fitting. This AD requires repetitive inspections for cracking of the MLG beam forward support fitting, and applicable on-condition actions. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective June 4, 2018.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of June 4, 2018.

**ADDRESSES:** For service information identified in this final rule, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this service information at the

FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–1248.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–1248; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for Docket Operations (phone: 800–647–5527) is Docket Operations, U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:**

Payman Soltani, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5313; fax: 562–627–5210; email: [payman.soltani@faa.gov](mailto:payman.soltani@faa.gov).

**SUPPLEMENTARY INFORMATION:****Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all The Boeing Company Model 737–100, –200, –200C, –300, –400, and –500 series airplanes. The NPRM published in the **Federal Register** on January 17, 2018 (83 FR 2375). The NPRM was prompted by reports of cracks found in the MLG beam forward support fitting. The NPRM proposed to require repetitive inspections for cracking of the MLG beam forward support fitting, and applicable on-condition actions.

We are issuing this AD to address cracking of the MLG beam forward support fitting on the inboard side of the wing buttock line (WBL) 157 rib. Undetected cracks could lead to a fuel leak, the inability of a principal structural element to carry limit load, or an MLG collapse that could prevent continued safe flight and landing.

**Comments**

We gave the public the opportunity to participate in developing this final rule. The following presents the comments received on the NPRM and the FAA’s response to each comment. The Boeing

Company had no objections to the NPRM.

### Effect of Winglets on Accomplishment of the Proposed Actions

Aviation Partners Boeing stated that accomplishing the Supplemental Type Certificate (STC) ST01219SE does not affect the actions specified in the NPRM.

We concur with the commenter. We have redesignated paragraph (c) of the proposed AD as paragraph (c)(1) of this AD and added paragraph (c)(2) to this AD to state that installation of STC ST01219SE does not affect the ability to accomplish the actions required by this AD. Therefore, for airplanes on which STC ST01219SE is installed, a “change in product” alternative method of compliance (AMOC) approval request is not necessary to comply with the requirements of 14 CFR 39.17.

### Conclusion

We reviewed the relevant data, considered the comments received, and determined that air safety and the public interest require adopting this final rule with the change described previously and minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for addressing the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

We also determined that these changes will not increase the economic burden on any operator or increase the scope of this final rule.

### Related Service Information Under 1 CFR Part 51

We reviewed Boeing Alert Service Bulletin 737–57A1334, dated September

26, 2017. The service information describes procedures for repetitive high frequency eddy current (HFEC) inspections for cracking of the MLG beam forward support fitting around the fastener locations common to the rear spar web, below the upper chord on the inboard side of the WBL 157 rib, and applicable on-condition actions (*e.g.*, repair). This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

### Costs of Compliance

We estimate that this AD affects 160 airplanes of U.S. registry. We estimate the following costs to comply with this AD:

#### ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
HFEC inspections .....	Up to 81 work-hours × \$85 per hour = Up to \$6,885 per inspection cycle.	\$0	Up to \$6,885 per inspection cycle.	Up to \$1,101,600 per inspection cycle.

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this AD. Because the number of work-hours can vary widely, depending on the inspection findings, these figures were not included in the service information.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive

Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

### Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities

under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2018–09–01 The Boeing Company:**  
Amendment 39–19257; Docket No. FAA–2017–1248; Product Identifier 2017–NM–162–AD.

#### (a) Effective Date

This AD is effective June 4, 2018.

#### (b) Affected ADs

None.

**(c) Applicability**

(1) This AD applies to all The Boeing Company Model 737-100, -200, -200C, -300, -400, and -500 series airplanes, certificated in any category.

(2) Installation of Supplemental Type Certificate (STC) ST01219SE ([http://rgl.faa.gov/Regulatory\\_and\\_Guidance\\_Library/rgstc.nsf/07ebd1cec7b301293e86257cb30045557a/\\$FILE/ST01219SE.pdf](http://rgl.faa.gov/Regulatory_and_Guidance_Library/rgstc.nsf/07ebd1cec7b301293e86257cb30045557a/$FILE/ST01219SE.pdf)) does not affect the ability to accomplish the actions required by this AD. Therefore, for airplanes on which STC ST01219SE is installed, a “change in product” alternative method of compliance (AMOC) approval request is not necessary to comply with the requirements of 14 CFR 39.17.

**(d) Subject**

Air Transport Association (ATA) of America Code 57, Wings.

**(e) Unsafe Condition**

This AD was prompted by the report of a crack indication in the main landing gear (MLG) beam forward support fitting on the inboard side of the wing buttock line (WBL) 157 rib, and multiple reports of similar crack findings on other airplanes. We are issuing this AD to address cracking of the MLG beam forward support fitting on the inboard side of the WBL 157 rib. Undetected cracks could lead to a fuel leak, the inability of a principal structural element to carry limit load, or an MLG collapse that could prevent continued safe flight and landing.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

(1) For Group 1 airplanes identified in Boeing Alert Service Bulletin 737-57A1334, dated September 26, 2017: Within 120 days after the effective date of this AD, inspect the airplane and do all applicable corrective actions using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(2) For Group 2 airplanes identified in Boeing Alert Service Bulletin 737-57A1334, dated September 26, 2017: Except as required by paragraph (h) of this AD, at the applicable times specified in paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737-57A1334, dated September 26, 2017, do all applicable actions identified as “RC” (required for compliance) in, and in accordance with, the Accomplishment Instructions of Boeing Alert Service Bulletin 737-57A1334, dated September 26, 2017.

**(h) Exceptions to Service Information Specifications**

(1) For purposes of determining compliance with the requirements of this AD: Where Boeing Alert Service Bulletin 737-57A1334, dated September 26, 2017, uses the phrase “the original issue date of this service bulletin,” this AD requires using “the effective date of this AD.”

(2) Where Boeing Alert Service Bulletin 737-57A1334, dated September 26, 2017,

specifies contacting Boeing, and specifies that action as RC: This AD requires repair using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: [9-ANM-LAACO-AMOC-Requests@faa.gov](mailto:9-ANM-LAACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) Except as required by paragraph (h)(2) of this AD: For service information that contains steps that are labeled as RC, the provisions of paragraphs (i)(4)(i) and (i)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(j) Related Information**

For more information about this AD, contact Payman Soltani, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5313; fax: 562-627-5210; email: [payman.soltani@faa.gov](mailto:payman.soltani@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Service Bulletin 737-57A1334, dated September 26, 2017.

(ii) Reserved.

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Des Moines, Washington, on April 11, 2018.

**Dionne Palermo,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018-08646 Filed 4-27-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Office of the Secretary****14 CFR Parts 205 and 298****Notification to UAS Operators Proposing To Engage in Air Transportation**

**AGENCY:** Office of the Secretary (OST), Department of Transportation (DOT).

**ACTION:** Notification of procedures.

**SUMMARY:** This document sets forth the procedure to seek an air taxi operator exemption to hold economic authority from the Department of Transportation (DOT or Department) for companies proposing to engage in certain air transportation operations with unmanned aircraft systems (UAS).

**DATES:** April 30, 2018.

**FOR FURTHER INFORMATION CONTACT:** Lauralyn Remo, Chief, Air Carrier Fitness Division (202) 366-5347, 1200 New Jersey Ave. SE, Washington, DC 20590.

**SUPPLEMENTARY INFORMATION:** In order to engage directly or indirectly in air transportation,<sup>1</sup> a citizen of the United

<sup>1</sup> “Air transportation” means foreign air transportation, interstate air transportation, or the transportation of mail by aircraft. Interstate air transportation includes the transportation of property by aircraft for compensation across state,