

**(j) Parts Installation Limitation**

As of the effective date of this AD, no person may install an MLG center door assembly on any airplane unless all actions for Group 3 airplanes identified as RC in, and in accordance with, the Accomplishment Instructions of BSASB 737-52-1170, R1, have been accomplished on that MLG center door assembly within the compliance times specified in Tables 4, 5, and 6, as applicable, of paragraph 1.E., Compliance, of BSASB 737-52-1170, R1.

**(k) Credit for Previous Actions**

This paragraph provides credit for the actions specified in paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Boeing Special Attention Service Bulletin 737-52-1170, dated July 29, 2014.

**(l) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (m)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) Except as required by paragraph (h) of this AD: For service information that contains steps that are labeled as RC, the provisions of paragraphs (l)(4)(i) and (l)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled "RC Exempt," then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(m) Related Information**

(1) For more information about this AD, contact Alan Pohl, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3527; email: [alan.pohl@faa.gov](mailto:alan.pohl@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on April 27, 2018.

Michael Kaszycki,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2018-09978 Filed 5-10-18; 8:45 am]

BILLING CODE 4910-13-P

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2018-0385; Product Identifier 2018-CE-019-AD]

RIN 2120-AA64

**Airworthiness Directives; Pacific Aerospace Limited Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for Pacific Aerospace Limited Model 750XL airplanes. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as an incorrect size bolt may have been used to assemble the elevator bellcrank pivot joint. We are issuing this proposed AD to require actions to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by June 25, 2018.

**ADDRESSES:** You may send comments by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** (202) 493-2251.

- **Mail:** U.S. Department of

Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Pacific Aerospace Limited, Airport Road, Hamilton, Private Bag 3027, Hamilton 3240, New Zealand; phone: +64 7843 6144; fax: +64 843 6134; email: [pacific@aerospace.co.nz](mailto:pacific@aerospace.co.nz); internet: [www.aerospace.co.nz](http://www.aerospace.co.nz). You may review copies of the referenced service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0385; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov).

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2018-0385; Product Identifier 2018-CE-019-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The Civil Aviation Authority (CAA), which is the aviation authority for New Zealand, has issued AD DCA/750XL/28, dated March 22, 2018 (referred to after this as “the MCAI”), to correct an unsafe condition for Pacific Aerospace Limited Model 750XL airplanes and was based on mandatory continuing airworthiness information originated by an aviation authority of another country. The MCAI states:

It is possible that the elevator bellcrank pivot joint could be assembled with a bolt P/N AN4–20 that is a little too short, leaving threads inside the working area of the section of the joint.

The MCAI requires inspecting the elevator bellcrank pivot joint to determine the length of the bolt installed to determine if it is the proper size and taking all necessary corrective actions. You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0385.

#### Related Service Information Under 14 CFR Part 51

Pacific Aerospace Limited has issued Service Bulletin PACSB/XL/097, Issue 1, dated March 12, 2018. The service information describes procedures for inspecting the elevator bellcrank pivot joint to determine if the correct bolt size is installed. If an incorrect size bolt is found, the service bulletin describes procedures for inspecting the cross tube to confirm structural integrity, taking necessary corrective actions, and replacing the incorrect size bolt with a correct sized bolt. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section of this NPRM.

#### FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with this State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all

information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Costs of Compliance

We estimate that this proposed AD will affect 22 products of U.S. registry. We also estimate that it would take about 2 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$3,740, or \$170 per product.

In addition, we estimate that any necessary follow-on actions would take about 8 work-hours and require parts costing \$125, for a cost of \$805 per product. We have no way of determining the number of products that may need these actions.

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to small airplanes, gliders, balloons, airships, domestic business jet

transport airplanes, and associated appliances to the Director of the Policy and Innovation Division.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**Pacific Aerospace Limited:** Docket No. FAA–2018–0385; Product Identifier 2018–CE–019–AD.

#### (a) Comments Due Date

We must receive comments by June 25, 2018.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Pacific Aerospace Limited Model 750XL airplanes, all serial numbers through 215, certificated in any category.

#### (d) Subject

Air Transport Association of America (ATA) Code 27: Flight Controls.

**(e) Reason**

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. We are issuing this proposed AD to prevent damage from the threads of the bolt on the internal bore of the cross tube hinge plate, which could result in reduced control.

**(f) Actions and Compliance**

Unless already done, do the following actions in paragraphs (f)(1) and (2) of this AD:

(1) Within the next 150 hours time-in-service after the effective date of this AD or within the next 12 months after the effective date of this AD, whichever occurs later, inspect the elevator bellcrank pivot joint to determine the length of the bolt installed. Do the inspection using the Inspection Instructions in Pacific Aerospace Service Bulletin PACSB/XL/097, Issue 1, dated March 12, 2018.

(2) If an incorrect size bolt is found during the inspection required in paragraph (f)(1) of this AD, before further flight, take all necessary corrective actions using the Accomplishment Instructions in Pacific Aerospace Service Bulletin PACSB/XL/097, Issue 1, dated March 12, 2018.

**(g) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Small Airplane Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, Small Airplane Standards Branch, FAA; or the Civil Aviation Authority of New Zealand (CAA).

**(h) Related Information**

Refer to MCAI Civil Aviation Authority (CAA) AD DCA/750XL/28, dated March 22, 2018, for related information. You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0385. For service information related to this AD, contact Pacific Aerospace Limited, Airport Road, Hamilton, Private Bag 3027, Hamilton 3240, New Zealand; phone: +64 7843 6144; fax: +64 843 6134; email: [pacific@aerospace.co.nz](mailto:pacific@ aerospace.co.nz); internet: [www.aerospace.co.nz](http://www.aerospace.co.nz). You may review this referenced service information at the FAA, Policy and Innovation Division, 901 Locust,

Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Issued in Kansas City, Missouri, on May 4, 2018.

**Melvin J. Johnson,**

*Deputy Director, Policy & Innovation Division, Aircraft Certification Service.*

[FR Doc. 2018-10016 Filed 5-10-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2018-0394; Product Identifier 2018-NM-036-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Dassault Aviation Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all Dassault Aviation Model MYSTERE-FALCON 50 airplanes. This proposed AD was prompted by a determination that more restrictive maintenance requirements and airworthiness limitations are necessary. This proposed AD would require revising the maintenance or inspection program, as applicable, to incorporate new and more restrictive maintenance requirements and airworthiness limitations. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by June 25, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; internet

<http://www.dassaultfalcon.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th Street, Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0394; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th Street, Des Moines, WA 98198; telephone and fax 206-231-3226.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2018-0394; Product Identifier 2018-NM-036-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

**Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2018-0026, dated January 30, 2018 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for all Dassault Aviation Model MYSTERE-FALCON 50 airplanes. The MCAI states:

The airworthiness limitations and certification maintenance instructions for the