

the Accomplishment Instructions of Boeing Requirements Bulletin 737–25–1758 RB, dated November 8, 2017.

**Note 1 to paragraph (g)(2) of this AD:** Guidance for accomplishing the actions required by this AD can be found in Boeing Service Bulletin 737–25–1758, dated November 8, 2017, which is referred to in Boeing Requirements Bulletin 737–25–1758 RB, dated November 8, 2017.

**(h) Exceptions to Service Information Specifications**

(1) For purposes of determining compliance with the requirements of this AD: Where Boeing Service Bulletin 737–25–1728, dated October 10, 2016, uses the phrase “the original issue date of this service bulletin,” this AD requires using “the effective date of this AD.”

(2) For purposes of determining compliance with the requirements of this AD: Where Boeing Requirements Bulletin 737–25–1758 RB, dated November 8, 2017, uses the phrase “the original issue date of the Requirements Bulletin (RB),” this AD requires using “the effective date of this AD.”

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) For service information that contains steps that are labeled as RC, the provisions of paragraphs (i)(4)(i) and (i)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance

or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(j) Related Information**

(1) For more information about this AD, contact Scott Craig, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206–231–3566; email: [Michael.S.Craig@faa.gov](mailto:Michael.S.Craig@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on June 21, 2018.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018–14397 Filed 7–5–18; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA–2018–0581; Product Identifier 2018–NM–029–AD]**

**RIN 2120–AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 777–200, –200LR, –300, and –300ER series airplanes. This proposed AD was prompted by a report that showed a non-compliance exists on some in-service galley attendant seat fitting installations. The non-compliance could result in flight attendant seats failing in a high-G crash. This proposed AD would require modifications for galley mounted seat fittings. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by August 20, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR

11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202–493–2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0581.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0581; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:**

Allison Buss, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206–231–3564; email: [Allison.buss@faa.gov](mailto:Allison.buss@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2018–0581; Product Identifier 2018–NM–029–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory,

economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

We have received a report that showed a non-compliance exists on some in-service galley attendant seat fitting installations. This condition, if not addressed, could result in flight attendant seats failing in a high-G crash, resulting in potential injury to flight attendants and consequent inability of the flight attendants to assist with passenger evacuation in a timely manner.

**Related Service Information Under 1 CFR Part 51**

We reviewed Boeing Special Attention Service Bulletin 777-25-0649, Revision 1, dated October 6, 2017. The service information describes procedures for modifications for galley mounted seat fittings. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

**FAA’s Determination**

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements**

This proposed AD would require accomplishment of the actions identified as “RC” (required for compliance) in the Accomplishment Instructions of Boeing Special Attention Service Bulletin 777-25-0649, Revision

1, dated October 6, 2017, described previously, except as discussed under “Differences Between this Proposed AD and the Service Information,” and except for any differences identified as exceptions in the regulatory text of this proposed AD.

For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0581.

**Differences Between This Proposed AD and the Service Information**

Boeing Special Attention Service Bulletin 777-25-0649, Revision 1, dated October 6, 2017, specifies the compliance time as 1,875 days. For this proposed AD, we specified the compliance time as 6 years. We have coordinated this difference with Boeing.

**Costs of Compliance**

We estimate that this proposed AD affects 50 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Modification .....	7 work-hours × \$85 per hour = \$595 .....	\$0	\$595	\$29,750

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all known costs in our cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on

products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a “significant regulatory action” under Executive Order 12866,

(2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**The Boeing Company:** Docket No. FAA–2018–0581; Product Identifier 2018–NM–029–AD.

**(a) Comments Due Date**

We must receive comments by August 20, 2018.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to The Boeing Company Model 777–200, –200LR, –300, and –300ER series airplanes, certificated in any category, as identified in Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017.

**(d) Subject**

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

**(e) Unsafe Condition**

This AD was prompted by a report that showed a non-compliance exists on some in-service galley attendant seat fitting installations. The non-compliance could result in flight attendant seats failing in a high-G crash. We are issuing this AD to address non-compliant flight attendant seats, which could fail in a high-G crash and result in potential injury to flight attendants and consequent inability of the flight attendants to assist with passenger evacuation in a timely manner.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Within 6 years after the effective date of this AD, do all applicable actions identified as “RC” (required for compliance) in, and in accordance with, the Accomplishment Instructions of Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017.

**(h) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (i)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair,

modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) For service information that contains steps that are labeled as RC, the provisions of paragraphs (h)(4)(i) and (h)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(i) Related Information**

(1) For more information about this AD, contact Allison Buss, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206–231–3564; email: [Allison.buss@faa.gov](mailto:Allison.buss@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on June 21, 2018.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018–14425 Filed 7–5–18; 8:45 am]

**BILLING CODE 4910–13–P**

**ENVIRONMENTAL PROTECTION AGENCY****40 CFR Part 52**

**[EPA–R06–OAR–2018–0350; FRL–9979–54–Region 6]**

**Approval and Promulgation of Implementation Plans; Oklahoma; General SIP Updates**

**AGENCY:** Environmental Protection Agency (EPA).

**ACTION:** Proposed rule.

**SUMMARY:** Pursuant to the Federal Clean Air Act (CAA or the Act), the Environmental Protection Agency (EPA) is proposing to approve revisions to the State Implementation Plan (SIP) for Oklahoma submitted by the State of Oklahoma designee with a letter dated February 14, 2017. The submittal covers updates to the Oklahoma SIP, as contained in annual SIP updates for 2013, 2014, 2015, and 2016, and incorporates the latest changes to EPA regulations. This action will address the revisions submitted to the Oklahoma SIP pertaining to incorporation by reference of federal requirements and emission inventory reporting requirements.

**DATES:** Written comments must be received on or before August 6, 2018.

**ADDRESSES:** Submit your comments, identified by Docket No. EPA–R06–OAR–2018–0350, at <http://www.regulations.gov> or via email to [wiley.adina@epa.gov](mailto:wiley.adina@epa.gov). Follow the online instructions for submitting comments. Once submitted, comments cannot be edited or removed from *Regulations.gov*. The EPA may publish any comment received to its public docket. Do not submit electronically any information you consider to be Confidential Business Information (CBI) or other information whose disclosure is restricted by statute. Multimedia submissions (audio, video, etc.) must be accompanied by a written comment. The written comment is considered the official comment and should include discussion of all points you wish to make. The EPA will generally not consider comments or comment contents located outside of the primary submission (*i.e.* on the web, cloud, or other file sharing system). For additional submission methods, please contact Adina Wiley, 214–665–2115, [wiley.adina@epa.gov](mailto:wiley.adina@epa.gov). For the full EPA public comment policy, information about CBI or multimedia submissions, and general guidance on making effective comments, please visit <http://www2.epa.gov/dockets/commenting-epa-dockets>.

**Docket:** The index to the docket for this action is available electronically at [www.regulations.gov](http://www.regulations.gov) and in hard copy at the EPA Region 6, 1445 Ross Avenue, Suite 700, Dallas, Texas. While all documents in the docket are listed in the index, some information may be publicly available only at the hard copy location (*e.g.*, copyrighted material), and some may not be publicly available at either location (*e.g.*, CBI).