

**(c) Applicability**

This AD applies to Dassault Aviation Model FALCON 2000, certificated in any category, manufacturer serial numbers 70 through 231 inclusive.

**(d) Subject**

Air Transport Association (ATA) of America Code 24, Electrical power.

**(e) Reason**

This AD was prompted by a report of chafing of a wire bundle located at the bottom of the right hand (RH) electrical cabinet. We are issuing this AD to address such chafing, which may cause damage to wires within the bundle, and, if not detected and corrected, could lead to improper functioning of airplane systems (such as loss of wing anti-icing or wing anti-icing inoperative indication, loss of normal braking indication, and loss of "No take-off" indication), which could result in reduced control of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspection**

Within 25 months after the effective date of this AD, for airplanes equipped with a metallic plate at the bottom of the RH electrical cabinet, do the following actions as specified in paragraphs (g)(1) and (g)(2) of this AD.

(1) Perform a general visual inspection of the wiring bundle for damage (including chafing), in accordance with the Accomplishment Instructions of Dassault Aviation Service Bulletin F2000-436, dated September 28, 2017.

(2) Measure the clearance between the metallic plate and the wire bundle at the bottom of the RH electrical cabinet in accordance with the Accomplishment Instructions of Dassault Aviation Service Bulletin F2000-436, dated September 28, 2017.

**(h) Corrective Action**

(1) If, during the inspection required by paragraph (g)(1) of this AD, any damage is found, before further flight, replace all damaged wires using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Dassault Aviation's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(2) If, during the measurement as required by paragraph (g)(2) of this AD, the detected clearance is less than the criteria as specified in Dassault Aviation Service Bulletin F2000-436, dated September 28, 2017, before further flight, modify the metallic plate in accordance with the Accomplishment Instructions of Dassault Aviation Service Bulletin F2000-436, dated September 28, 2017.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or EASA; or Dassault Aviation's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2018-0114, dated May 23, 2018, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0809.

(2) For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3226.

(3) For service information identified in this AD, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; internet <http://www.dassaultfalcon.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on September 26, 2018.

**John P. Piccola,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018-21609 Filed 10-5-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2018-0805; Product Identifier 2018-NM-103-AD]

RIN 2120-AA64

**Airworthiness Directives; Airbus Defense and Space S.A. (Formerly Known as Construcciones Aeronauticas, S.A.) Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Defense and Space S.A. Model CN-235, CN-235-200 and CN-235-300 airplanes. This proposed AD was prompted by a determination that new or more restrictive airworthiness limitations are necessary. This proposed AD would require revising the maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by November 23, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Airbus Defense and Space, Services/Engineering support, Avenida de Aragón 404, 28022 Madrid, Spain; telephone: +34 91 585 55 84; fax: +34 91 585 31 27; email:

[MTA.TechnicalService@airbus.com](mailto:MTA.TechnicalService@airbus.com).

You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0805; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Shahram Daneshmandi, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3220.

### SUPPLEMENTARY INFORMATION:

#### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2018-0805; Product Identifier 2018-NM-103-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2018-0134, dated June 25, 2018 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Airbus Defense and Space S.A. Model CN-235, CN-235-200, and CN-235-300 airplanes. The MCAI states:

The airworthiness limitations and/or certification maintenance instructions for the EADS-CASA CN-235 aeroplanes, which are approved by EASA, are currently defined and published in the Airbus D&S CN-235 ALL [Airworthiness Limitations List] DT-86-3001 document. These instructions have been identified as mandatory for continued airworthiness.

Failure to accomplish these instructions could result in an unsafe condition [*i.e.*, fatigue cracking, damage, and corrosion in principal structural elements, which could result in reduced structural integrity of the airplane].

For the reason described above, this [EASA] AD requires accomplishment of the actions specified in the ALL.

You may examine the MCAI in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0805.

### Related Service Information Under 1 CFR Part 51

Airbus Defence and Space has issued CN-235 Airworthiness Limitations List, DT-86-3001, Issue R, dated March 20, 2018. This service information describes airworthiness limitations for airplane systems, structural inspections, safe life structural items, and safe life system items. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

### FAA's Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design.

### Proposed Requirements of This NPRM

This proposed AD would require revising the maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations.

This proposed AD would require revisions to certain operator maintenance documents to include new actions (*e.g.*, inspections). Compliance with these actions is required by 14 CFR 91.403(c). For airplanes that have been previously modified, altered, or repaired in the areas addressed by this proposed AD, the operator may not be able to accomplish the actions described in the revisions. In this situation, to comply with 14 CFR 91.403(c), the operator must request approval for an alternative method of compliance according to paragraph (i)(1) of this proposed AD.

### Differences Between This Proposed AD and the MCAI or Service Information

The MCAI specifies that if there are findings from the airworthiness limitations section (ALS) inspection tasks, corrective actions must be accomplished in accordance with Airbus maintenance documentation. However, this proposed AD does not include that requirement. Operators of U.S.-registered airplanes are required by general airworthiness and operational regulations to perform maintenance using methods that are acceptable to the FAA. We consider those methods to be adequate to address any corrective actions necessitated by the findings of ALS inspections required by this proposed AD.

### Airworthiness Limitations Based on Type Design

The FAA recently became aware of an issue related to the applicability of ADs that require incorporation of an ALS revision into an operator's maintenance or inspection program.

Typically, when these types of ADs are issued by civil aviation authorities of other countries, they apply to all airplanes covered under an identified type certificate (TC). The corresponding FAA AD typically retains applicability to all of those airplanes.

In addition, U.S. operators must operate their airplanes in an airworthy condition, in accordance with 14 CFR 91.7(a). Included in this obligation is the requirement to perform any maintenance or inspections specified in the ALS, and in accordance with the ALS as specified in 14 CFR 43.16 and 91.403(c), unless an alternative has been approved by the FAA.

When a type certificate is issued for a type design, the specific ALS, including revisions, is a part of that type design, as specified in 14 CFR 21.31(c).

The sum effect of these operational and maintenance requirements is an obligation to comply with the ALS defined in the type design referenced in the manufacturer's conformity statement. This obligation may introduce a conflict with an AD that requires a specific ALS revision if new airplanes are delivered with a later revision as part of their type design.

To address this conflict, the FAA has approved alternative methods of compliance (AMOCs) that allow operators to incorporate the most recent ALS revision into their maintenance/inspection programs, in lieu of the ALS revision required by the AD. This eliminates the conflict and enables the operator to comply with both the AD and the type design.

However, compliance with AMOCs is normally optional, and we recently became aware that some operators choose to retain the AD-mandated ALS revision in their fleet-wide maintenance/inspection programs, including those for new airplanes delivered with later ALS revisions, to help standardize the maintenance of the fleet. To ensure that operators comply with the applicable ALS revision for newly delivered airplanes containing a later revision than that specified in an AD, we plan to limit the applicability of ADs that mandate ALS revisions to those airplanes that are subject to an earlier revision of the ALS, either as part of the type design or as mandated by an earlier AD.

This proposed AD therefore would apply to Model CN-235, CN-235-200 and CN-235-300 airplanes with an original certificate of airworthiness or original export certificate of airworthiness that was issued on or before the date of the ALS revision identified in this proposed AD. Operators of airplanes with an original certificate of airworthiness or original export certificate of airworthiness issued after that date must comply with the airworthiness limitations specified as part of the approved type design and referenced on the type certificate data sheet.

#### Costs of Compliance

We estimate that this proposed AD affects 9 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

We have determined that revising the maintenance or inspection program takes an average of 90 work-hours per operator, although we recognize that this number may vary from operator to operator. In the past, we have estimated that this action takes 1 work-hour per airplane. Since operators incorporate maintenance or inspection program changes for their affected fleet(s), we have determined that a per-operator estimate is more accurate than a per-airplane estimate. Therefore, we estimate the total cost per operator to be \$7,650 (90 work-hours × \$85 per work-hour)

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII,

Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus Defense and Space S.A. (Formerly Known as Construcciones Aeronauticas, S.A.):** Docket No. FAA-2018-0805; Product Identifier 2018-NM-103-AD.

#### (a) Comments Due Date

We must receive comments by November 23, 2018.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Airbus Defense and Space S.A. (formerly known as Construcciones Aeronauticas, S.A.) Model CN-235, CN-235-200, and CN-235-300 airplanes, all manufacturer serial numbers, certificated in any category, with an original certificate of airworthiness issued on or before March 20, 2018. This AD does not apply to Model CN-235-300 airplanes in a Maritime Patrol (SM01) configuration.

#### (d) Subject

Air Transport Association (ATA) of America Code 05, Time Limits/Maintenance Checks.

#### (e) Reason

This AD was prompted by a determination that new or more restrictive airworthiness limitations are necessary. We are issuing this AD to address fatigue cracking, damage, and corrosion in principal structural elements; such fatigue cracking, damage, and corrosion could result in reduced structural integrity of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Maintenance or Inspection Program Revision

Within 90 days after the effective date of this AD, revise the maintenance or inspection program, as applicable, to incorporate the information specified in Airbus Defence and Space CN-235 Airworthiness Limitations List, DT-86-3001, Issue R, dated March 20, 2018. The initial compliance times for doing the tasks are at the applicable times specified in Airbus Defence and Space CN-235 Airworthiness Limitations List, DT-86-3001, Issue R, dated March 20, 2018, or within 90 days after the effective date of this AD, whichever occurs later.

#### (h) No Alternative Actions or Intervals

After accomplishment of the revision required by paragraph (g) of this AD, no alternative actions (e.g., inspections) or intervals, may be used unless the actions or intervals are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (i)(1) of this AD.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Airbus Defense and Space S.A.'s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2018-0134, dated June 25, 2018, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0805.

(2) For more information about this AD, contact Shahram Daneshmandi, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3220.

(3) For service information identified in this AD, Airbus Defense and Space, Services/Engineering support, Avenida de Aragón 404, 28022 Madrid, Spain; telephone: +34 91 585 55 84; fax: +34 91 585 31 27; email: [MTA.TechnicalService@airbus.com](mailto:MTA.TechnicalService@airbus.com). You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on September 19, 2018.

**John P. Piccola,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018-21608 Filed 10-5-18; 8:45 am]

**BILLING CODE 4910-13-P**

**CONSUMER PRODUCT SAFETY COMMISSION****16 CFR Part 1130**

[Docket No. CPSC-2018-0018]

**Amendment to Requirements for Consumer Registration of Durable Infant or Toddler Products**

**AGENCY:** Consumer Product Safety Commission.

**ACTION:** Proposed rule.

**SUMMARY:** In 2009, the Consumer Product Safety Commission (CPSC) fulfilled a statutory requirement in the Consumer Product Safety Improvement Act of 2008 (CPSIA) to issue a rule requiring manufacturers of durable infant or toddler products to establish a consumer registration program. The Commission now proposes to amend the definition of “durable infant or toddler product” in the rule to include the full statutory definition; clarify that the scope of each listed product category is further defined in the applicable mandatory standard; clarify listed product categories using the product name in the applicable mandatory standard; and clarify the scope of the infant carriers and bassinets and cradles product categories.

**DATES:** Submit comments by December 24, 2018.

**ADDRESSES:** Comments, identified by Docket No. CPSC-2018-0018, may be submitted electronically or in writing:

*Electronic Submissions:* Submit electronic comments to the Federal eRulemaking Portal at: <http://www.regulations.gov>. Follow the instructions for submitting comments. CPSC does not accept comments submitted by electronic mail (email), except through [www.regulations.gov](http://www.regulations.gov). CPSC encourages you to submit electronic comments by using the Federal eRulemaking Portal, as described above.

*Written Submissions:* Submit written submissions in the following way: Mail/Hand delivery/Courier (for paper, disk, or CD-ROM submissions) to: Division of the Secretariat, Consumer Product Safety Commission, Room 820, 4330 East-West Highway, Bethesda, MD 20814; telephone (301) 504-7923.

*Instructions:* All submissions received must include the agency name and docket number for this proposed rulemaking. All comments received may be posted without change, including any personal identifiers, contact information, or other personal information provided, to: <http://www.regulations.gov>. Do not submit

electronically any confidential business information, trade secret information, or other sensitive or protected information that you do not want to be available to the public. If you wish to provide such information, please submit it in writing.

*Docket:* For access to the docket to read background documents or comments received, go to: <http://www.regulations.gov>, and insert the docket number, CPSC-2018-0018, into the “Search” box, and follow the prompts.

**FOR FURTHER INFORMATION CONTACT:** Hope EJ Nesteruk, Project Manager, Children’s Program Manager, Division of Mechanical and Combustion Engineering, Consumer Product Safety Commission, 5 Research Place, Rockville, MD 20850; telephone: 301-987-2579; email: [HNesteruk@cpsc.gov](mailto:HNesteruk@cpsc.gov).  
**SUPPLEMENTARY INFORMATION:**

**I. Background and Statutory Authority**

Section 104 of the Consumer Product Safety Improvement Act of 2008 (CPSIA) is the Danny Keysar Child Product Safety Notification Act. Section 104 of the CPSIA requires that for “durable infant or toddler products,” the U.S. Consumer Product Safety Commission (CPSC) must (1) issue a mandatory rule for each product based on the applicable voluntary standard, and (2) issue a rule requiring consumer registration for such products. 15 U.S.C. 2056a(b) and (d).<sup>1</sup> In 2009, the Commission issued a regulation to implement the second requirement, that manufacturers provide a means for consumers to register “durable infant or toddler products,” so that consumers can receive direct notification in the event of a product recall. The rule is codified at 16 CFR part 1130, Requirements for Consumer Registration of Durable Infant or Toddler Products (“part 1130” or the “consumer registration rule”).

The two aspects of section 104, consumer registration and product standards, are both based on the definition of “durable infant or toddler product” set forth in section 104(f) of the CPSIA: “durable products intended for use, or that may be reasonably expected to be used, by children under the age of 5 years.” The statute lists 12 product categories included within the definition, such as cribs, toddler beds, high chairs, strollers, and swings. In a

<sup>1</sup> Since 2009, the Commission has issued final rules for 22 durable infant or toddler products, and issued one proposed rule for Inclined Infant Sleep Products that has not yet been finalized. Mandatory standards for durable infant or toddler products are codified in 16 CFR parts 1215 through 1235, and part 1237. Part 1236 is reserved for Inclined Infant Sleep Products.