

NUCLEAR REGULATORY COMMISSION

10 CFR Parts 15, 170, and 171

[NRC–2023–0212]

3150–AL 12

Fee Schedules; Fee Recovery for Fiscal Year 2026

Correction

In rule document 2026–12067 beginning on page 36470 in the issue of Tuesday, June 16, 2026, make the following corrections:

On pages 6504 and 6505, § 171.16 7.C in Table 2 to Paragraph (d) should read as follows:

C. Other licenses issued under parts 30, 35, 40, and 70 of this chapter for human use of byproduct material, source material, and/or special nuclear material, except licenses for byproduct material, source material, or special nuclear material in sealed sources contained in teletherapy devices. This category also includes the possession and use of source material for shielding when authorized on the same license.^{9 17 19} Number of locations of use: 1–5. [Program Code(s): 02120, 02121, 02200, 02201, 02210, 02220, 02230, 02231, 02240, 221601 \$23,300

(1). Other licenses issued under parts 30, 35, 40, and 70 of this chapter for human use of byproduct material, source material, and/or special nuclear material, except licenses for byproduct material, source material, or special nuclear material in sealed sources contained in teletherapy devices. This category also includes the possession and use of source material for shielding when authorized on the same license.^{9 17 19} Number of locations of use: 6–20. [Program Code(s): 04810, 04812, 04814, 04816, 04818, 04820, 04822, 04824, 04826, 048281 \$33,000

(2). Other licenses issued under parts 30, 35, 40, and 70 of this chapter for human use of byproduct material, source material, and/or special nuclear material, except licenses for byproduct material, source material, or special nuclear material in sealed sources contained in teletherapy devices. This category also includes the possession and use of source material for shielding when authorized on the same license.^{9 17 19} Number of locations of use: more than 20. [Program Code(s): 04811, 04813, 04815, 04817, 04819, 04821, 04823, 04825, 04827, 04829]

[FR Doc. C1–2026–12067 Filed 10–16–26; 8:45 am]

BILLING CODE 1505–01–D

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2025–0004; Project Identifier AD–2024–00094–T; Amendment 39–23486; AD 2026–20–13]

RIN 2120–AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain The Boeing Company Model 737–600, –700, –700C, –800, –900, and –900ER series airplanes. This AD was prompted by a report that some passenger service unit (PSU)-mounted video monitors became detached from the PSU rails during a hard landing. This AD requires replacing PSU-mounted video monitors that do not have secondary retention lanyards. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective November 23, 2026.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of November 23, 2026.

ADDRESSES:

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2025–0004; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

Material Incorporated by Reference:

- For the material identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; website myboeingfleet.com.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2025–0004.

FOR FURTHER INFORMATION CONTACT: Julie Linn, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206–231–3584; email: julie.linn@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain The Boeing Company Model 737–600, –700, –700C, –800, –900, and –900ER series airplanes. The NPRM was published in the **Federal Register** on January 17, 2025 (90 FR 5751). The NPRM was prompted by a report that some PSU-mounted video monitors became detached from the PSU rails during a hard landing that did not exceed the emergency load requirements for the PSUs. In the NPRM, the FAA proposed to require replacing PSU-mounted video monitors that do not have secondary retention lanyards. The FAA is issuing this AD to address PSU-mounted video monitors that could become fully detached or be held at an unsafe height, which, if not addressed, could result in injury to passengers and impede passenger and crew egress during emergency evacuation.

Discussion of Final Airworthiness Directive

Comments

The FAA received a comment from Boeing, who supported the NPRM without change.

The FAA received additional comments from five commenters, including All Nippon Airways Co., Ltd. (ANA), Aviation Partners Boeing, Delta Air Lines, Inc. (Delta), Panasonic Avionics Corporation (Panasonic), and an individual. The following presents the comments received on the NPRM and the FAA’s response to each comment.

Request To Clarify Method for Determining Applicability

Delta requested that the FAA clarify that they can accomplish either a physical inspection for the existence of PSU-mounted video monitors or accomplish a review of Delta’s PSU Layouts (Delta’s PSU drawing configuration) to determine if this AD applies.

The FAA agrees to clarify that operators can determine if their airplanes are equipped with PSU-mounted video monitors by performing a physical inspection or a records check, provided the presence of PSU-mounted video monitors can be conclusively

determined from that review; either method is acceptable to determine if this AD applies. The FAA did not change this AD in response to this comment.

Effect of Winglets on Accomplishment of the Proposed Actions

Aviation Partners Boeing stated that the installation of blended or split scimitar winglets per supplemental type certificate (STC) ST00830SE does not affect compliance with the mandated actions in the proposed rule.

The FAA agrees with the commenter that STC ST00830SE does not affect compliance with this AD. Therefore, the installation of STC ST00830SE does not affect the ability to accomplish the actions required by this AD. The FAA did not change this AD in response to this comment.

Request To Revise Paragraph (e) To Clarify Safety Concerns

Panasonic requested that the FAA revise paragraph (e) of the proposed AD to include the statement, "Although some models of PSU-mounted video monitors have not become detached under such landings, we have determined that this AD is warranted due to relative motion between the PSU rails that drive forces exceeding the approved emergency landing conditions for the attached PSU-mounted monitors." Panasonic asserted that the improvement action for Panasonic monitors involves an enhancement to its fail-safe design and is not a result of correcting any defect or noncompliance in the PSU-mounted monitor assemblies themselves. Panasonic requested this change to avoid potentially misleading operators that Panasonic monitors have become detached because they did not meet the existing emergency landing requirements they were designed to meet.

The FAA acknowledges the commenter's concern. The FAA is unaware of Panasonic monitors that have become detached during hard landings that did not exceed emergency landing requirements. However, paragraph (e) of this AD specifies that some, not all, PSU-mounted video monitors became detached. The FAA did not change this AD in response to this comment.

Request To Include Panasonic Service Bulletin SB141908-44-001 as an Accepted Method of Compliance

Panasonic requested that the FAA include Panasonic Service Bulletin SB141908-44-001 as an accepted method of compliance for the proposed AD but did not provide the specified

service bulletin to the FAA. Panasonic asserted that the effectivity of Boeing Special Attention Requirements Bulletin 737-25-1858 RB does not include airplanes with STCs that have identical parts that would be affected by the NPRM and suggested that adding this service bulletin as an accepted method of compliance would reduce the FAA's efforts to support alternative methods of compliance (AMOC) requests to address airplanes installed with FAA STC ST02908NY.

The FAA disagrees. Paragraph (g)(3) of this AD requires airplanes not identified in the effectivity paragraph of either Boeing service bulletin to perform the required actions using an AMOC. At this time, the FAA does not have enough data to approve Panasonic Service Bulletin SB141908-44-001 as an accepted method of compliance for this AD. The FAA did not change this AD in response to this comment.

Requests To Refer to Later Revisions of the Service Information

ANA requested that the FAA update the service information referenced in the proposed AD. The commenter noted that Boeing Special Attention Requirements Bulletin 737-25-1851 RB, dated December 15, 2023, and Boeing Special Attention Requirements Bulletin 737-25-1858 RB, dated December 15, 2023, will be revised by Boeing to correct an error in the airplane effectivity and asked the FAA to include the revised service information in the AD when published.

Delta requested that the FAA add the latest revisions of the Panasonic Service Bulletins referenced in Boeing Special Attention Requirements Bulletin 737-25-1858 RB, dated December 15, 2023, as a method of compliance for the proposed AD. Delta stated that Boeing released a preliminary revision of the requirements bulletin that references the latest revisions of the Panasonic Service Bulletins.

An individual noted that there are later revisions of the Burrana Service Bulletins referenced in Boeing Special Attention Requirements Bulletin 737-25-1851 RB, dated December 15, 2023. The commenter did not make a specific request for FAA action.

The FAA agrees to use the latest service information in this AD. Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025, and Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025, add instructions for installing lanyard retention brackets at locations where there are no holes in the PSU inboard rail and at locations with oval-shaped

holes for airplanes without a Boeing Sky Interior (BSI) in groups 1 and 2. The revised service information removes from the effectivity Model 737-800 airplanes that have been modified to a Boeing Converted Freighter; this information does not affect the applicability of this AD. The revised service information specifies later revisions of the Burrana and Panasonic service bulletins, as applicable. Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025, specifies an additional inspection for airplanes in groups 1 and 2 that have a PSU-mounted video monitor installed at a cabin temperature sensor location and have accomplished the original issue of the service information, because the original issue could not be complied with to address the unsafe condition. Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025, also specifies credit for accomplishing the original issue of the service information for airplanes in groups 3 and 4.

The FAA has revised this AD to mandate Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025, and Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025. The FAA has revised paragraph (i)(1) of this AD to add credit for previous actions for airplanes that completed Boeing Special Attention Requirements Bulletin 737-25-1851 RB, dated December 15, 2023, and redesignated subsequent paragraphs accordingly. The FAA also added paragraph (i)(2) of this AD to add credit for previous actions for airplanes that completed Boeing Special Attention Requirements Bulletin 737-25-1858 RB, dated December 15, 2023, for airplanes identified as groups 3 and 4 only.

Conclusion

The FAA reviewed the relevant data, considered any comments received, and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products. Except for minor editorial changes, and any other changes described previously, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator.

Material Incorporated by Reference Under 1 CFR Part 51

The FAA reviewed Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025. This material specifies procedures

for replacing certain Burrana PSU-mounted video monitors that do not have secondary retention lanyards with PSU-mounted video monitors that have secondary retention lanyards.

The FAA also reviewed Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025. This material specifies procedures for replacing certain Panasonic PSU-mounted video monitors that do not have secondary retention lanyards with PSU-mounted video

monitors that have secondary retention lanyards. This material specifies an additional inspection of the inboard PSU rail and applicable on-condition actions for airplanes in groups 1 and 2 that have a PSU-mounted video monitor installed at a cabin temperature sensor location and have accomplished the original issue of the service information. On-condition actions include attaching the secondary retention lanyard torsion spring to either the 1-inch hole found

during inspection or the retention bracket, as necessary.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

The FAA estimates that this AD affects 459 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per monitor	Cost on U.S. operators
Replacement (Burrana monitors—airplanes identified Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025).	2 work-hours × \$85 per hour = \$170, per monitor.	\$2,734	\$2,904	Up to \$5,401,440 * (62 airplanes).
Replacement (Panasonic monitors—airplanes identified in Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025).	2 work-hours × \$85 per hour = \$170, per monitor.	\$354	\$524	Up to \$5,376,240 * (342 airplanes).
Replacement (monitors for airplanes not identified in the Boeing service information).	2 work-hours × \$85 per hour = \$170, per monitor.	Up to \$2,734	Up to \$2,904	Up to \$4,791,600 * (55 airplanes).

* An airplane may have up to 30 monitors.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and

responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2026-20-13 The Boeing Company:

Amendment 39-23486; Docket No. FAA-2025-0004; Project Identifier AD-2024-00094-T.

(a) Effective Date

This airworthiness directive (AD) is effective November 23, 2026.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 737-600, -700, -700C, -800, -900, and -900ER series airplanes, certificated in any category, equipped with passenger service unit (PSU)-mounted video monitors.

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

(e) Unsafe Condition

This AD was prompted by a report that some PSU-mounted video monitors became detached from the PSU rails during a hard landing that did not exceed the emergency load requirements for the PSUs. The FAA is issuing this AD to address PSU-mounted video monitors that could become fully detached or be held at an unsafe height, which, if not addressed, could result in

injury to passengers and impede passenger and crew egress during emergency evacuation.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

(1) For airplanes identified in Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025: Except as specified by paragraph (h) of this AD, at the applicable times specified in the "Compliance" paragraph of Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025.

Note 1 to paragraph (g)(1): Guidance for accomplishing the actions required by paragraph (g)(1) of this AD can be found in Boeing Special Attention Service Bulletin 737-25-1851, Revision 1, dated July 15, 2025, which is referred to in Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025.

(2) For airplanes identified in Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025: Except as specified by paragraph (h) of this AD, at the applicable times specified in the "Compliance" paragraph of Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025.

Note 2 to paragraph (g)(2): Guidance for accomplishing the actions required by paragraph (g)(2) of this AD can be found in Boeing Special Attention Service Bulletin 737-25-1858, Revision 1, dated July 15, 2025, which is referred to in Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025.

(3) For airplanes not identified in paragraph (g)(1) or (2) of this AD: Within 60 months after the effective date of this AD, replace all PSU-mounted video monitors that do not have secondary retention lanyards with PSU-mounted video monitors that have secondary retention lanyards, using a method approved in accordance with the procedures specified in paragraph (j) of this AD.

(h) Exceptions to Service Information Specifications

(1) Where the Compliance Time columns of the tables in the "Compliance" paragraph of Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025, refer to the original issue date of Requirements Bulletin 737-25-1851 RB, this AD requires using the effective date of this AD.

(2) Where the Compliance Time columns of the tables in the "Compliance" paragraph of Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated

July 15, 2025, refer to the original issue date of Requirements Bulletin 737-25-1858 RB or the Revision 1 date of Requirements Bulletin 737-25-1858 RB, this AD requires using the effective date of this AD.

(3) Where Boeing Special Attention Requirements Bulletins 737-25-1851 RB, Revision 1, and 737-25-1858 RB, Revision 1, both dated July 15, 2025, specify contacting Boeing for alternative installation instructions and doing the installation: This AD requires doing the installation using a method approved in accordance with the procedures specified in paragraph (j) of this AD.

(i) Credit for Previous Actions

(1) For airplanes identified in Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025: This paragraph provides credit for the actions specified in paragraph (g)(1) of this AD, if those actions were performed before the effective date of this AD using Boeing Special Attention Requirements Bulletin 737-25-1851 RB, dated December 15, 2023.

(2) For airplanes in groups 3 and 4 as identified in Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025: This paragraph provides credit for the actions specified in paragraph (g)(2) of this AD, if those actions were performed before the effective date of this AD using Boeing Special Attention Requirements Bulletin 737-25-1858 RB, dated December 15, 2023.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, AIR-520, Continued Operational Safety Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (k)(1) of this AD. Information may be emailed to: AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, AIR-520, Continued Operational Safety Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(k) Additional Information

(1) For more information about this AD, contact Julie Linn, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3584; email: julie.linn@faa.gov.

(2) Material identified in this AD that is not incorporated by reference is available at the address specified in paragraph (l)(3) of this AD.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Special Attention Requirements Bulletin 737-25-1851 RB, Revision 1, dated July 15, 2025.

(ii) Boeing Special Attention Requirements Bulletin 737-25-1858 RB, Revision 1, dated July 15, 2025.

(3) For Boeing material identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website myboeingfleet.com.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on October 1, 2026.

Brian Knaup,

Acting Deputy Director, Integrated Certificate Management Division, Aircraft Certification Service.

[FR Doc. 2026-21332 Filed 10-16-26; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2026-4643; Project Identifier AD-2025-01612-E; Amendment 39-23495; AD 2026-21-06]

RIN 2120-AA64

Airworthiness Directives; Pratt & Whitney Division Engines

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Pratt & Whitney Division (PW) Model PW4052, PW4056, PW4060, PW4060A, PW4060C, PW4062, PW4062A, PW4152, PW4156, PW4156A, PW4158, PW4460, and PW4462 engines. This AD was prompted by multiple reports of tailpipe fire, loss of thrust control, and engine in-flight shutdown due to